

Building and Pest Inspection Report

Provided By



Building Assessment Unit

131 Summerhill Road, Glen Iris, VIC, 3146

P 0473427438

info@buildingassessmentunit.com.au

Property Address

19 Example STREET, Exemptown, VIC, 3000



Report Information

Client Information

Client Name	Example CLIENT
Report ordered by	Example CLIENT
Client Email	example@example.com.au

Inspection Information

Report/Agreement #	2603241243469
Inspection Date:	26 Mar 2024
Inspection Time:	12:43 pm

Pest And Building Inspection

The Scope of the Inspection: This report Complies with Australian Standards AS 4349.1-2007. Inspection of Buildings Part 1: Pre- Purchase Inspections-Residential Buildings- Appendix "C" and with AS 4349.3-2010 (Visual Timber Pest Inspection Report)

Only the purchaser name at the front page of the report "Client" should rely on this report. If this report has been issued to you by a third party. You are not to rely on its findings or contents and seek to obtain your own independent pre purchase inspection report as this report or its contents is non transferable. The inspection WILL NOT report on items listed in Appendix "D" of AS43491.2007.

If the property is part of a Strata or Company Title , then Appendix "B" of the Australian Standards applies.

Special Requirements: Unless stated otherwise in the report It is acknowledged that there are no special requirements placed on this inspection that are outside the scope of the abovementioned Australian Standard.

Inspection Agreement: This report is subject to the terms, scope, description and limitations of the inspection agreement that was entered into prior to the inspection being performed. (Note: This agreement may have been entered into by your Solicitor/Conveyancer or other agent). If you are unsure in any way as to how that inspection agreement impacts this inspection and report, please seek clarification prior to committing to the property.

Changes to the Inspection Agreement: Unless stated otherwise in the report It is acknowledged that if any inspection agreement is in place in respect to this inspection, no changes have been made between the scope of the pre-Inspection Agreement and the scope of this inspection report.

Please read the entire report. Refer to the terms & conditions as they form part of the report

Areas to be Inspected and Restrictions

The Building and the site including fencing that is up to 30 meters from the building and within the boundaries of the site. Where present and accessible, the Inspection shall include.

- (a) The interior of the building.
- (b) The roof space.
- (c) The exterior of the building
- (d) The sub-floor space
- (e) The roof exterior
- (f) The property within 30 m of the building subject to inspection.

Visual Inspection Only

This is a visual inspection only limited to those areas and sections of the property fully accessible and visible to the inspector on the date of inspection. The inspection did not include breaking apart, dismantling, removing or moving objects including, but not limited to, foliage, mouldings, roof insulation/ sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances or personal possessions. The inspector cannot see inside walls, between floors, inside skillion roofing, behind stored goods in cupboards and other areas that are concealed or obstructed. The inspector did not dig, gouge, force or perform any other invasive procedures. Visible timbers cannot be destructively probed or hit without the written permission of the property owner.

Very Important note to the purchaser.

In the event that areas where access could not be gained ie: locked areas or rooms where physical access could not be gained, structural defects, termite damage or activity may be present but not seen. Access should be provided and a follow up or re-Inspection should be undertaken prior to a contract of sale becoming binding. Please consult with the vendor and request full access to restricted areas. This should be done prior to a decision to purchase.

Table of Contents

1. SITE
2. EXTERIOR
3. GARAGE - CARPORT
4. ROOF AND GUTTER
5. INTERIORS
6. BATHROOM(S)
7. KITCHEN & LAUNDRY
8. ROOF VOID
9. SUBFLOOR
10. CONCLUSION
11. PROPERTY AND INSPECTION INFORMATION
12. ACCESS AND RESTRICTIONS
13. TIMBER PEST FINDINGS
14. CONDUCTIVE CONDITIONS
15. OVERALL ASSESSMENT

Summary Of Major Defects And Safety Hazards

Below Is A Summary Of Significant Items Requiring Immediate Action.

Section	Location	Name	Comment
SITE	Fences & Gates	Overall Condition	The front brick fence is leaning and is a hazard. Removal and replacement is required. We recommend that a fence builder is engaged to assess and rectify.
SITE	Fences & Gates	Overall Condition	The shared wall garage to the adjoining neighbours property had extensive structural cracking and is at risk of collapse. This is a hazard and major structural defect which may affect the health and safety of the occupants and propping of the garage wall is urgently required. We recommend that a structural engineer is engaged to assess and provide further recommendations.
SITE	Trees	Tree Findings	Trees are close to dwelling. There is visible wall cracking in the vicinity. Engage a Structural Engineer and qualified arborist to carry out an assessment on potential issues.
EXTERIOR	Eaves	Eave Condition	Fibrous Cement Sheeting cladding sections. We recommend an ASBESTOS Inspection be conducted by a licensed Asbestos Inspector prior to a decision to purchase. Considered a Safety Hazard
EXTERIOR	Windows	Overall Condition	Gaps between window frame and wall cladding evident - This can be due to wall movement or footings settlement. A structural engineer should be engaged for advice and recommendations.
EXTERIOR	Walls	Condition	<p>Cracks noted (Damage Category 3 to 4)</p> <p>Possible causes may be foundation movement, Support structure deflection, Thermal movement and moisture uptake or loss, failure under external loads. In the inspectors opinion these cracks require further assessment. A structural engineer should be consulted for further evaluation and advice. This is considered a major structural defect subject to engineers assessment.</p> <p><i>For clarification on the category of cracks with a damage category of 3 to 4, please refer to Cracking of Building Elements in Section 2D of the Terms and Conditions of this report.</i></p>
EXTERIOR	Chimney	Condition	The cowl to the top appears to be missing however access is unavailable to this area due to the height. Missing cowl may allow water ingress into the property. We recommend that a chimney specialist is engaged to assess and rectify.
GARAGE - CARPORT	Garaging	Roof And Gutter	Rust on roof sheeting. A qualified roofing plumber should be engaged for repairs.
GARAGE - CARPORT	Garaging	Roof And Gutter	Sheet fixings lifted. A qualified roofer should be engaged for immediate repairs due to water ingress into the roof cavity.

GARAGE - CARPORT	Garaging	Wall Cladding Findings	Cracks noted. Possible causes may be foundation movement. Support structure deflection. Thermal movement and moisture uptake or loss, failure under external loads. A structural engineer should be consulted for further evaluation and advice.
GARAGE - CARPORT	Garaging	Ceiling Findings	Ceiling sagging - Requires repair from a safety perspective. I recommend you contact a qualified plasterer for further advice and recommendations.
GARAGE - CARPORT	Carport	Overall Condition	The carport is in poor condition and replacement is required. We recommend that a carport builder is engaged to assess and rectify.
ROOF AND GUTTER	Roof Covering	Roof Clad Condition	<p>The roof sheets are not adequately sloped to direct water toward the box gutter, exhibiting negative fall in certain areas.</p> <p>This issue may lead to water accumulation (ponding) and the potential for water penetration into the roof void, particularly beneath the ridge caps, with further risk of capillary action of rainwater at the ends of the sheets.</p> <p>It is advisable to engage the services of a qualified roof plumber to evaluate the situation and implement the necessary corrective measures.</p>
ROOF AND GUTTER	Roof Covering	Roof Clad Condition	A hip cap has slipped and rectification is required. We recommend that a roof tiler is engaged to assess and rectify.
ROOF AND GUTTER	Roof Covering	Flashing Conditions	Gaps are present to some flashings and may allow for water ingress into the property. We recommend that a roof plumber is engaged to assess and rectify.
ROOF AND GUTTER	Downpipes	Downpipe Findings	Rust penetrations observed to downpipe. Over time this has potential to cause differential settlement to the footings, cause rising damp and is also conducive to termite infestation. A qualified plumber should be engaged for advice and recommendations.
INTERIORS	Living Room	Flooring	Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to assess and provide further recommendations.
INTERIORS	Hallway/s	Flooring	Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to assess and provide further recommendations.
INTERIORS	Bedroom 1	Ceiling	Ceiling sagging - Requires immediate repairs to prevent further collapse. Contact a qualified plasterer for repairs.
INTERIORS	Bedroom 1	Flooring	Unevenness visible in floor which is generally caused due to by excessive movement/settlement. We recommend that a structural engineer is engaged to assess and rectify.

INTERIORS	Bedroom 2	Flooring	Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.
INTERIORS	Bedroom 3	Flooring	Unevenness visible in floor. Possibly due to poor workmanship or excessive movement/settlement. A qualified carpenter should be engaged for advice and recommendations re levelling.
INTERIORS	Bedroom 4	Flooring	Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.
BATHROOM(S)	Powder Room	Flooring	Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.
BATHROOM(S)	Bathroom 1	Flooring	Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.
KITCHEN & LAUNDRY	Kitchen and Pantry	Floor	Cracked floor tiles - Recommendations: A qualified tiler should be engaged for advice and recommendations. This needs to be repaired at the earliest as this has the potential to lead to many related issues such as damp, water ingress to other areas.
KITCHEN & LAUNDRY	Kitchen and Pantry	Floor	Unevenness visible in floor which is generally caused due to by excessive movement/settlement. We recommend that a structural engineer is engaged to assess and rectify.
KITCHEN & LAUNDRY	Laundry	Floor	Cracked floor tiles - Recommendations: A qualified tiler should be engaged for advice and recommendations. This needs to be repaired at the earliest as this has the potential to lead to many related issues such as damp, water ingress to other areas.
KITCHEN & LAUNDRY	Laundry	Floor	Unevenness visible in floor which is generally caused due to by excessive movement/settlement. We recommend that a structural engineer is engaged to assess and rectify.
ROOF VOID	Roof Void Findings	Roof Cladding	Efflorescence observed indicating water absorption. White stains on tile roofs are typically an efflorescence deposit and may indicate that the tile is absorbing water, thus nearing end of life. A qualified roof restorer/tiler should be engaged for advice and recommendations.
CONCLUSION	Condition Of Inspected Structure	The incidence of Major Defects	The incidence of major defects in this residential building as compared with similar buildings is considered HIGH

TIMBER PEST FINDINGS	3.4 Durable Notice	Was a Treatment Notice Found	No termite management program has been installed to this property and the property is susceptible to termite attack. We strongly recommend that a termite management professional is engaged to install a program in accordance to AS3660. Talk to your inspector about recommendations.
----------------------	--------------------	------------------------------	--

Summary Of Minor Defects

**Below Is A Summary Of Defects Other Than Major Defects.
You should not rely on the summary only. Please read the entire report.**

Section	Location	Name	Comment
SITE	Paths	Pathways Condition	The concrete path is in poor condition replacement recommended. Contact a qualified concreter for repairs.
SITE	Fences & Gates	Overall Condition	The front brick fence has settlement/movement cracks. This may be a potential safety hazard. A qualified brick layer should be engaged for repairs.
SITE	Fences & Gates	Overall Condition	Some sections of the fence have general aging to the components. General upkeep and maintenance required and possible replacement of sections that cannot be repaired may be required. A qualified fencing contractor should be engaged for repairs.
SITE	Fences & Gates	Overall Condition	Sections of the fence components have rot. Repairs are required by fencing contractor.
SITE	Surface Drainage	Drainage Findings	The ground levels along the perimeter walls at the front of the home did not appear to fall away from the property walls sufficiently due to the natural landscape and contour. This will need to be assessed during a period of rainfall and if surface water appears to be entering the sub floor if applicable or ponding against the perimeter walls, engage a plumber or landscaper to assess and rectify as required. All drains should be regularly checked by a plumber and kept clean of debris to allow surface water to be carried away from the dwelling.
SITE	Surface Drainage	Drains	Poor drainage and/or areas where water is ponding around the perimeter of the home was identified. We recommend that addition drainage is installed to the perimeter of the home to mitigate water ingress into the subfloor area. A plumber should be engaged to assess and rectify.
SITE	Surface Drainage	Drains	We recommend that all external paths, and soil is graded away from the dwelling.
EXTERIOR	Eaves	Eave Condition	Eave lining stains observed. Normally this occurs due to overflow in blocked gutters. Recommendations. Gutters should be kept clear of debris and eave linings can then be painted or repaired as required.
EXTERIOR	Eaves	Eave Condition	Quad deteriorated or detached in areas and repair/replacement is required. We recommend that a carpenter is engaged to assess and rectify.
EXTERIOR	Windows	Overall Condition	General age/damage has occurred to window components. Recommendations: Restoration work recommended. A qualified carpenter should be engaged for advice and recommendations.

EXTERIOR	Walls	Condition	<p>There appears to have been some settlement in the building which has caused some cracking to the walls. These crack are catergorized as 0 to 2. This can also cause some doors to bind or be out of square. In the inspectors opinion these cracks are due to settlement, usually due to ground movement and subsequent movement to building materials can be expected. Any cracks should be monitored and if cracks increase in size, further investigation should be carried out by a structural engineer.</p> <p><i>For clarification on the catergy of cracks please refer to Cracking of Building Elements in Section 2D of the Terms and Conditions contained in this report.</i></p>
EXTERIOR	Walls	Condition	Minor decay was noted to the external wall lining. We recommend replacement of all affected timbers.
EXTERIOR	Walls	Condition	Sections of the cladding where the weatherboard meets the end stop have gaps which may allow water ingress to occur. We recommend that a caulking contractor is engaged to assess and seal.
EXTERIOR	Rising Damp	Damp Proof Course	A damp proof course is not visible or could not be visually identified. This may cause rising damp issues in the future. Contact a rising damp specialist to further investigate and make recommendation.
GARAGE - CARPORT	Garaging	Window Findings	Timber fungal decay and water damage on window frames. A qualified carpenter should be engaged for to assess and rectify.
ROOF AND GUTTER	Roof Covering	Roof Clad Condition	Minor cracking to the bedding motar and pointing was identified and maintenance of these areas is required. We recommend that a roof tiler is engaged to assess and rectify.
ROOF AND GUTTER	Roof Covering	Flashing Conditions	Flashing fixings lifted or not sufficiently installed may allow water ingress to occur into the roof cavity. A qualified roof plumber should be engaged for repairs and recommendations.
ROOF AND GUTTER	Roof Covering	Flashing Conditions	The valleys are corroded and replacement is required. We recommend that a roof plumber is engaged to assess and rectify.
ROOF AND GUTTER	Roof Covering	Flashing Conditions	There is an inadequate clearance to the soaker between the flashing and tiles, which may allow for debris to collect and water ingress to occur. We recommend that a roof plumber is engaged to assess and rectify.
ROOF AND GUTTER	Guttering	Gutter Findings	Debris in guttering areas- this requires cleaning out to prevent blocking of downpipes and leaking into eaves and fascia. Have gutters cleaned and assessed by a plumber for adequate fall. Regularly clean to prevent ponding. Ponding water will contribute to rust.

ROOF AND GUTTER	Downpipes	Downpipe Findings	Downpipe/s not connected to storm water discharge - Downpipes not connected to storm water have the potential to cause differential settlement to the footings, cause rising damp and is also conducive to termite infestation. A qualified roof plumber should be engaged for advice and recommendations.
INTERIORS	Living Room	Ceiling	Ceiling stains - No moisture readings obtained. These may have been repaired however you will need to monitor after a prolonged period of rainfall. If leaking persists, a qualified plumber should be engaged for advice and recommendations. All water damaged plaster should be replaced.
INTERIORS	Hallway/s	Ceiling	Settlement Cracks Noted. These are typical and generally patch and paint will suffice, however monitoring these cracks is advised for 12 months and if they become worse, further investigation by a suitably qualified professional is advised.
INTERIORS	Bedroom 1	Door	Uneven / out of square door causing binding. A qualified carpenter should be engaged to refit.
INTERIORS	Bedroom 1	Ceiling	Nail popping observed to the ceiling lining. This is should be repaired as soon as possible by a qualified plasterer to avoid any unsafe conditions.
INTERIORS	Bedroom 1	Walls	Settlement Cracks Noted. These are typical and generally patch and paint will suffice, however we recommend monitor these cracks and if become wider or longer, you will need to contact a structural engineers to assess.
INTERIORS	Bedroom 1	Windows	Movement/settlement/unevenness in frame. A qualified carpenter should be engaged for advice and recommendations.
BATHROOM(S)	Bathroom 1	Walls	Settlement Cracks Noted . These are typical and generally patch and paint will suffice, however Monitoring these cracks advised for 12 months and if become wider or longer, you will need to contact a structural engineers to assess.
BATHROOM(S)	Bathroom 1	Shower And Bath	Large gaps were present to the shower screen and maintenance or replacement is required. We recommend that a shower screen contractor is engaged to assess and rectify.
BATHROOM(S)	Bathroom 1	Ventilation	Exhaust fan is installed but not operable. A qualified electrician should be engaged for advice and recommendations.
KITCHEN & LAUNDRY	Kitchen and Pantry	Windows	Binding window/s - This can relate to some differential settlement in the footings, frame movement, age and the like. It can also be seasonal where the windows may bind for some months and then open and close sufficiently. Recommendations: If binding is persistent, a qualified carpenter should be engaged for advice and recommendations.
KITCHEN & LAUNDRY	Kitchen and Pantry	Cupboards And Bench Tops	Water damage to cabinet observed. Replacement required. Contact a cabinet maker for repairs.
KITCHEN & LAUNDRY	Laundry	Ceiling	Ceiling paint flake/deterioration is evident. Recommendations: General maintenance / painting as required.

CONCLUSION	Condition Of Inspected Structure	The Incidence of Minor Defects	The incidence of minor defects in this residential building as compared with similar buildings is considered TYPICAL
------------	----------------------------------	--------------------------------	---

SITE


Driveway

Materials

The driveway is concrete.

Driveway Condition




Common cracks were observed on the driveway. Whilst these cracks appeared to be typical at the time of inspection, we strongly recommend you monitor these cracks and if worsening occurs contact a concreter for further advice.

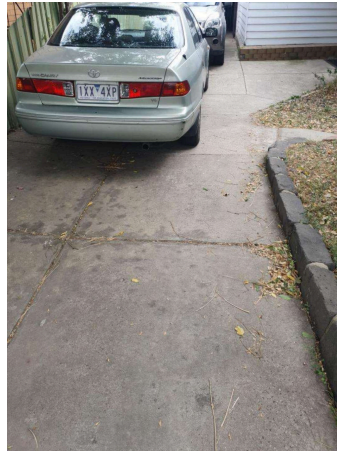

Paths

Pathways Condition



The concrete path is in poor condition replacement recommended. Contact a qualified concreter for repairs.

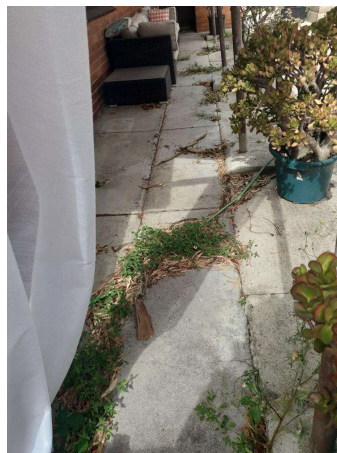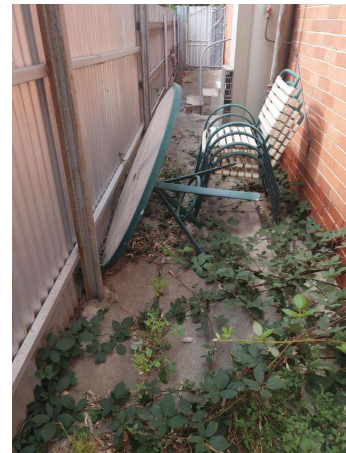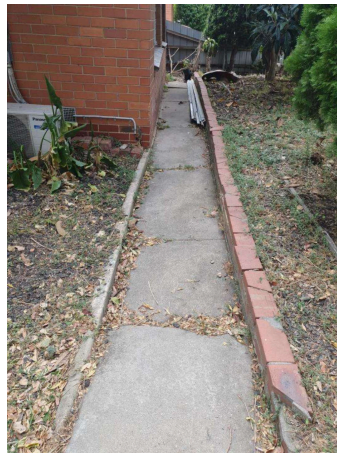

Fences & Gates

Overall Condition

The front brick fence has settlement/movement cracks. This may be a potential safety hazard. A qualified brick layer should be engaged for repairs. Damage was noted to the metal fence. Contact a fencing contractor for repairs. Some sections of the fence have general aging to the components. General upkeep and maintenance required and possible replacement of sections that cannot be repaired may be required. A qualified fencing contractor should be engaged for repairs. Sections of the fence components have rot. Repairs are required by fencing contractor. The front brick fence is leaning and is a hazard. Removal and replacement is required. We recommend that a fence builder is engaged to assess and rectify. The shared wall garage to the adjoining neighbours property had extensive structural cracking and is at risk of collapse. This is a hazard and major structural defect which may affect the health and safety of the occupants and propping of the garage wall is urgently required. We recommend that a structural engineer is engaged to assess and provide further recommendations.

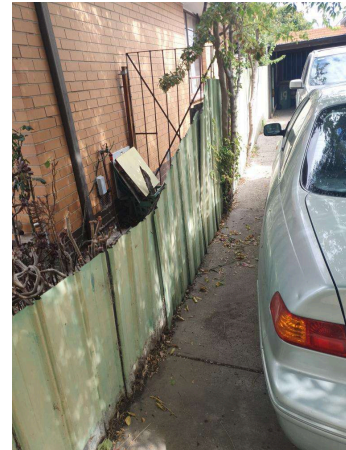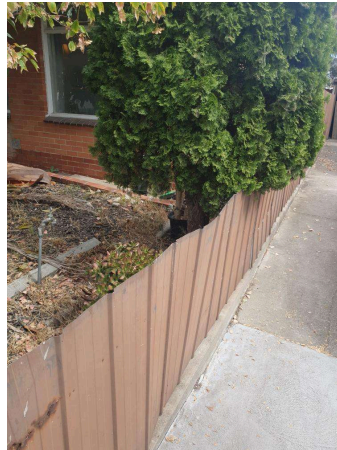


Surface Drainage
Drainage Findings

The ground levels along the perimeter walls at the front of the home did not appear to fall away from the property walls sufficiently due to the natural landscape and contour. This will need to be assessed during a period of rainfall and if surface water appears to be entering the sub floor if applicable or ponding against the perimeter walls, engage a plumber or landscaper to assess and rectify as required. All drains should be regularly checked by a plumber and kept clean of debris to allow surface water to be carried away from the dwelling.



Ideal Water Runoff

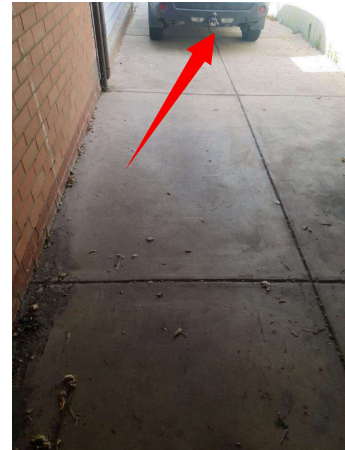

Drains

Poor drainage and/or areas where water is ponding around the perimeter of the home was identified. We recommend that addition drainage is installed to the perimeter of the home to mitigate water ingress into the subfloor area. A plumber should be engaged to assess and rectify.


We recommend that all external paths, and soil is graded away from the dwelling.

Trees

Tree Findings

Trees are close to dwelling. There is visible wall cracking in the vicinity. Engage a a Structural Engineer and qualified arborist to carry out an assessment on potential issues.

A large tree is present close to the home with roots systems that may impact the home. We recommend that an arborist is engaged to assess and provide further recommendations.

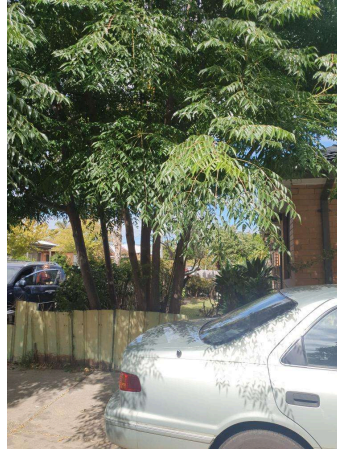

EXTERIOR

Entry Porch Area

Overall Condition

The entry porch serviceable or in reasonable or condition for the age of this dwelling.

External Door Components


Door Findings

On Visual Inspection the external condition of the doors is serviceable.

Eaves

Eave Condition


Fibrous Cement Sheeting cladding sections. We recommend an ASBESTOS Inspection be conducted by a licensed Asbestos Inspector prior to a decision to purchase. Considered a Safety Hazard
 Eave lining stains observed. Normally this occurs due to overflow in blocked gutters. Recommendations. Gutters should be kept clear of debris and eave linings can then be painted or repaired as required.
 Quad deteriorated or detached in areas and repair/replacement is required. We recommend that a carpenter is engaged to assess and rectify.

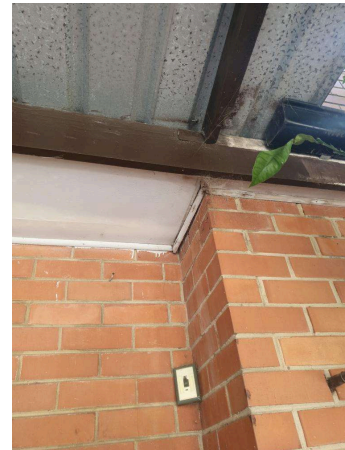

Fascia and Barge Boards

Condition

On visual inspection, the general condition of the fascia/barge boards is serviceable.

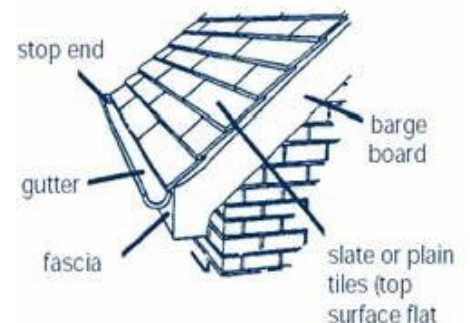

Windows

General Disclaimer

Please refer to section 2D of the Terms And Conditions Section of this report

Overall Condition




General age/damage has occurred to window components.

Recommendations:

Restoration work recommended. A qualified carpenter should be engaged for advice and recommendations.

Gaps between window frame and wall cladding evident -

This can be due to wall movement or footings settlement. A structural engineer should be engaged for advice and recommendations.

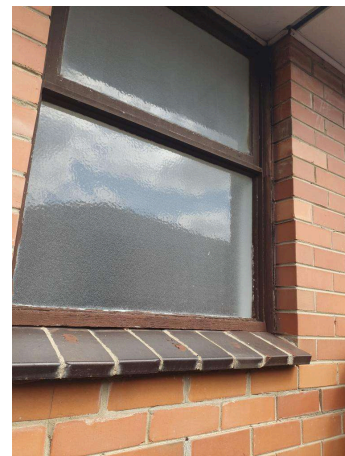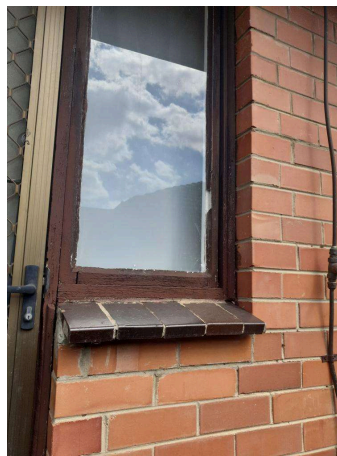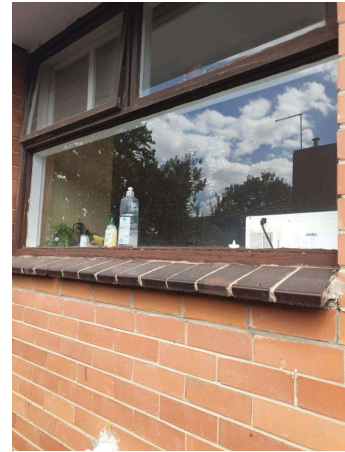

Walls

General Disclaimer

Refer to Section 2D of the Terms And Conditions section of this report.

Exterior Wall Material

Brick.




Condition

There appears to have been some settlement in the building which has caused some cracking to the walls. These cracks are categorized as 0 to 2. This can also cause some doors to bind or be out of square. In the inspectors opinion these cracks are due to settlement, usually due to ground movement and subsequent movement to building materials can be expected. Any cracks should be monitored and if cracks increase in size, further investigation should be carried out by a structural engineer.

For clarification on the category of cracks please refer to Cracking of Building Elements in Section 2D of the Terms and Conditions contained in this report.
Cracks noted (Damage Category 3 to 4)

Possible causes may be foundation movement, Support structure deflection, Thermal movement and moisture uptake or loss, failure under external loads. In the inspectors opinion these cracks require further assessment. A structural engineer should be consulted for further evaluation and advice. This is considered a major structural defect subject to engineers assessment.

For clarification on the category of cracks with a damage category of 3 to 4, please refer to Cracking of Building Elements in Section 2D of the Terms and Conditions of this report.
 Minor decay was noted to the external wall lining. We recommend replacement of all affected timbers. Sections of the cladding where the weatherboard meets the end stop have gaps which may allow water ingress to occur. We recommend that a caulking contractor is engaged to assess and seal.

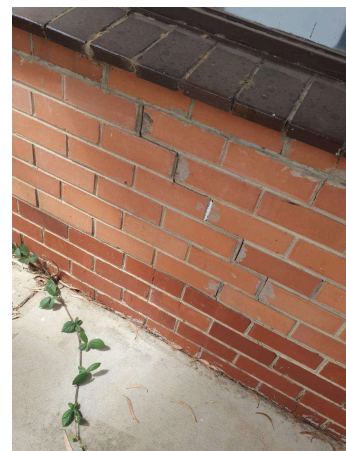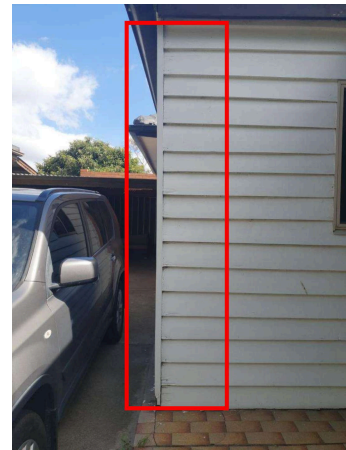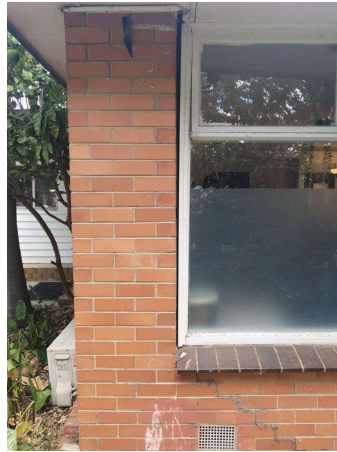

Chimney

General Disclaimer

Refer to Section 2D of the Terms And Conditions section of this report.

Condition

The cowl yo the top appears to be missing however access is unavailable to this area due to the height. Missing cowl may allow water ingress into the property. We recommend that a chimney specialist is engaged to assess and rectify.




Rising Damp

Rising Damp Findings

Of the visible and accessible areas, there was no visible evidence of excessive rising damp on the external walls at time of inspection.

Damp Proof Course


A damp proof course is not visible or could not be visually identified. This may cause rising damp issues in the future. Contact a rising damp specialist to further investigate and make recommendation.

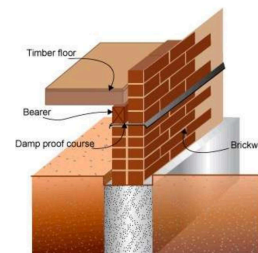

Weep Holes and Ventilation

Findings

The vents are unobstructed.

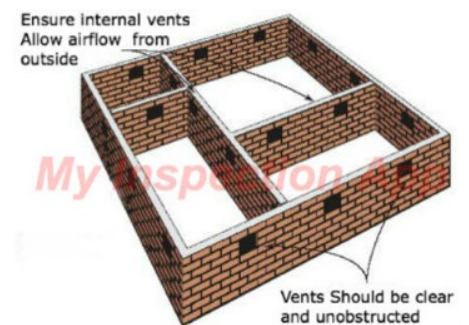

Alfresco Area

Overall Condition

Visible sections of the Alfresco area are serviceable or in reasonable or condition for the age of this dwelling.

GARAGE - CARPORT

Garaging

Type

Detached garage.

Roof And Gutter

Rust on roof sheeting. A qualified roofing plumber should be engaged for repairs. Sheet fixings lifted. A qualified roofer should be engaged for immediate repairs due to water ingress into the roof cavity.



Wall Cladding Findings

Cracks noted. Possible causes may be foundation movement. Support structure deflection. Thermal movement and moisture uptake or loss, failure under external loads. A structural engineer should be consulted for further evaluation and advice.



Ceiling Findings

Ceiling sagging - Requires repair from a safety perspective. I recommend you contact a qualified plasterer for further advice and recommendations.



Window Findings

Louver window pane missing - Recommendations: A qualified glazier contractor should be engaged for advice and recommendations.


Timber fungal decay and water damage on window frames. A qualified carpenter should be engaged for to assess and rectify.



Carport

Overall Condition

The carport is in poor condition and replacement is required. We recommend that a carport builder is engaged to assess and rectify.

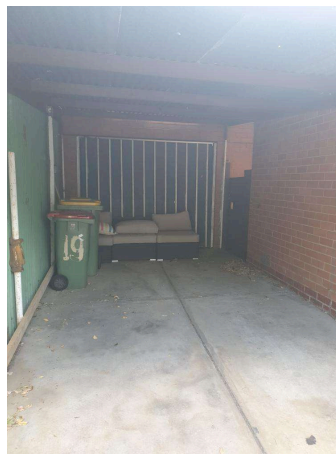

ROOF AND GUTTER

Roof Covering

General Disclaimer



Refer to Section 2C of the Terms And Conditions section of this report

Roof Covering Type

The roof is of concrete tiles.

Overall Condition

On inspection, defects were noted that may require further assessment and recommendations by licensed roofer.

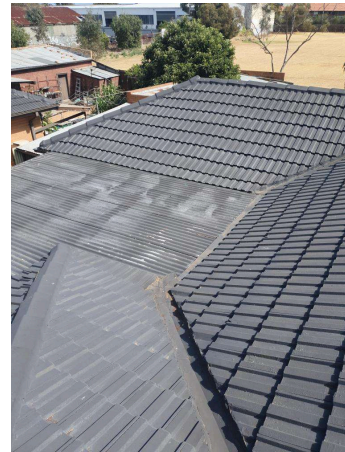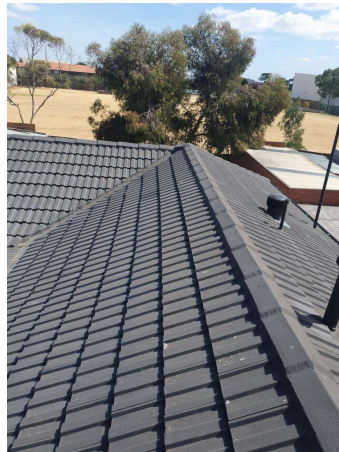



Roof Clad Condition

Minor cracking to the bedding mortar and pointing was identified and maintenance of these areas is required. We recommend that a roof tiler is engaged to assess and rectify. The roof sheets are not adequately sloped to direct water toward the box gutter, exhibiting negative fall in certain areas.

This issue may lead to water accumulation (ponding) and the potential for water penetration into the roof void, particularly beneath the ridge caps, with further risk of capillary action of rainwater at the ends of the sheets.


It is advisable to engage the services of a qualified roof plumber to evaluate the situation and implement the necessary corrective measures.

A hip cap has slipped and rectification is required. We recommend that a roof tiler is engaged to assess and rectify.

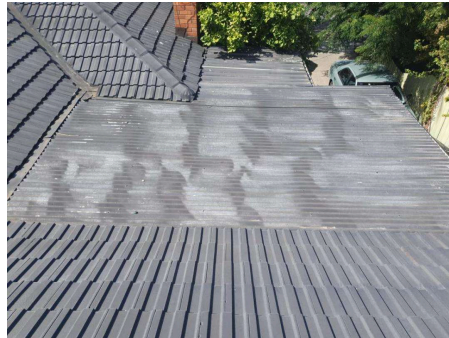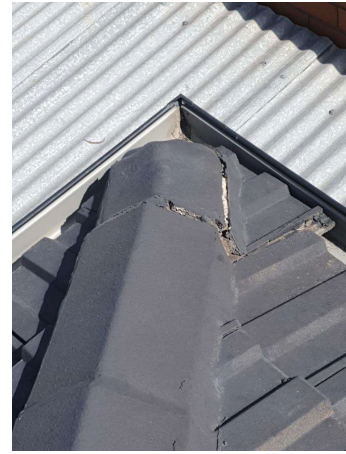

Flashing Conditions

Flashing fixings lifted or not sufficiently installed may allow water ingress to occur into the roof cavity. A qualified roof plumber should be engaged for repairs and recommendations. Gaps are present to some flashings and may allow for water ingress into the property. We recommend that a roof plumber is engaged to assess and rectify. The valleys are corroded and replacement is required. We recommend that a roof plumber is engaged to assess and rectify. There is an inadequate clearance to the soaker between the flashing and tiles, which may allow for debris to collect and water ingress to occur. We recommend that a roof plumber is engaged to assess and rectify.

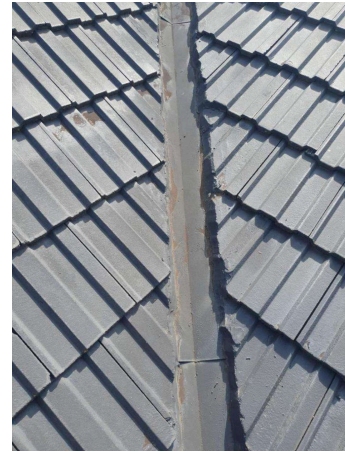



Gap to flashing allowing water ingress



Guttering

Gutter Findings


Debris in guttering areas- this requires cleaning out to prevent blocking of downpipes and leaking into eaves and fascia. Have gutters cleaned and assessed by a plumber for adequate fall. Regularly clean to prevent ponding. Ponding water will contribute to rust.

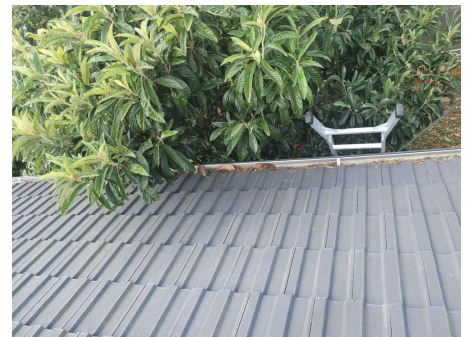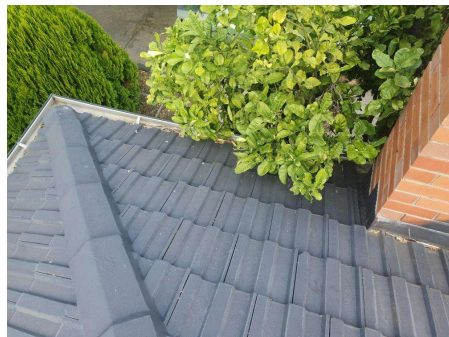

Downpipes

Downpipe Findings

Downpipe/s not connected to storm water discharge - Downpipes not connected to storm water have the potential to cause differential settlement to the footings, cause rising damp and is also conducive to termite infestation. A qualified roof plumber should be engaged for advice and recommendations. Rust penetrations observed to downpipe. Over time this has potential to cause differential settlement to the footings, cause rising damp and is also conducive to termite infestation. A qualified plumber should be engaged for advice and recommendations.

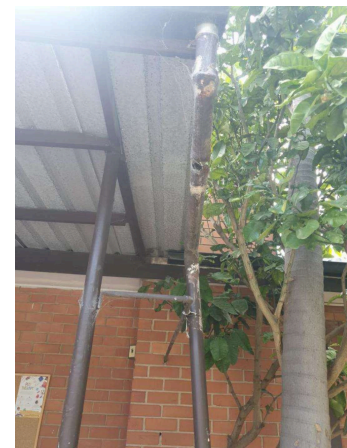

INTERIORS


Doors

General Disclaimer

Please refer to section 2F of the Terms And Condition section of this report

Front Entry Doors








The doors are in serviceable condition with no notable defects observed.

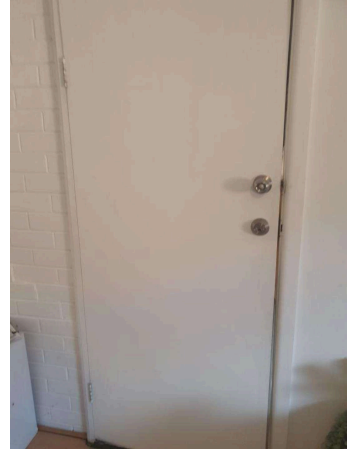

Living Room




Overall Condition

On inspection, defects were present that will require further assessing and recommendations by a qualified trades persons, please read below for details.

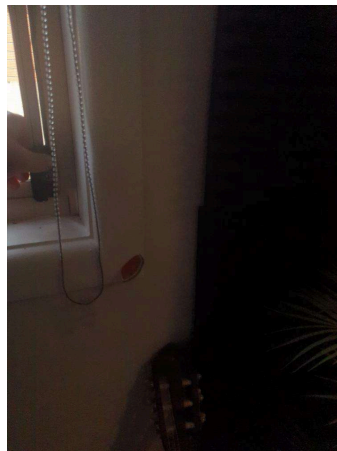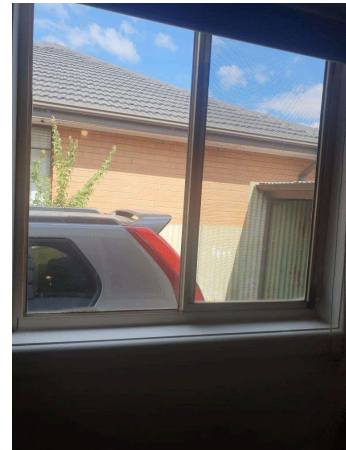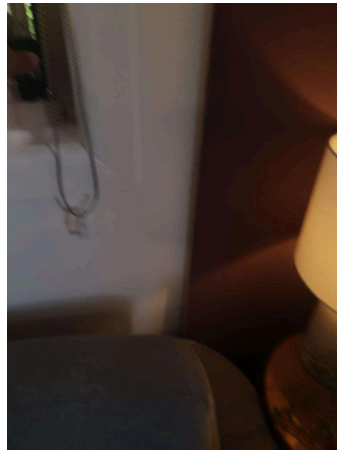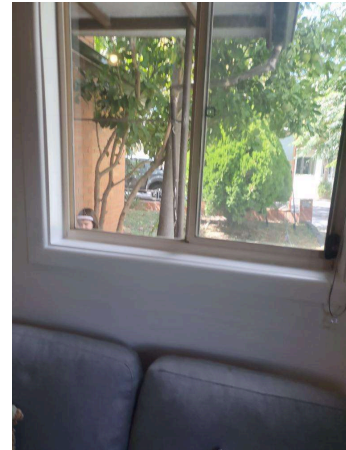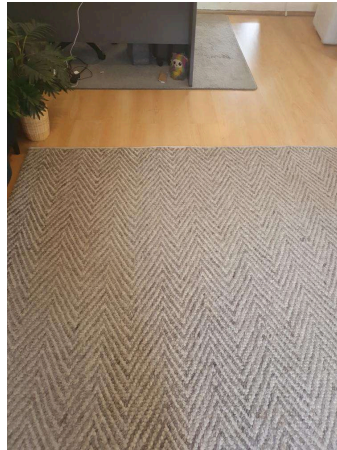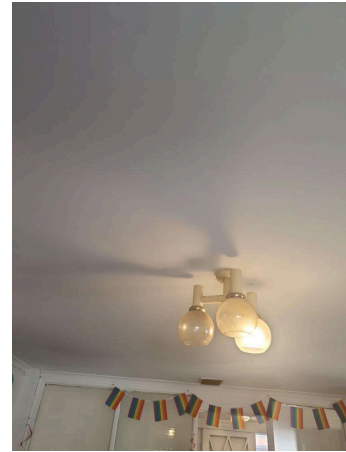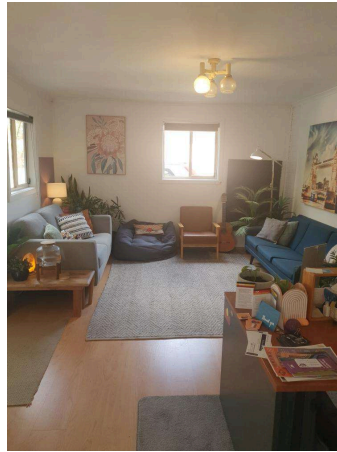


Ceiling

Ceiling stains - No moisture readings obtained. These may have been repaired however you will need to monitor after a prolonged period of rainfall. If leaking persists, a qualified plumber should be engaged for advice and recommendations. All water damaged plaster should be replaced.

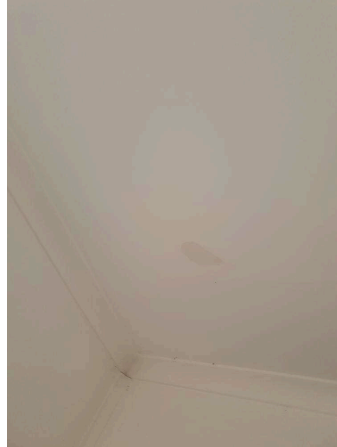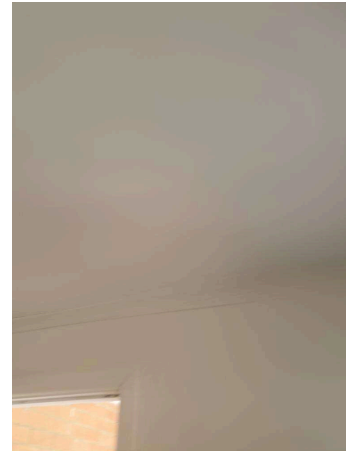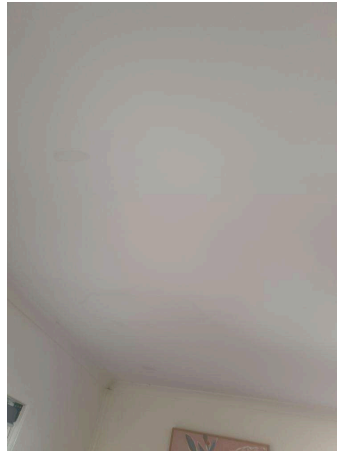

Flooring



Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.

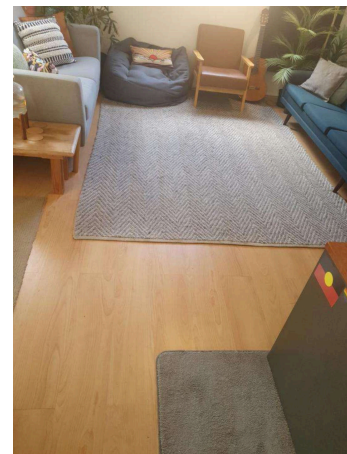

Hallway/s

Overall Condition

On inspection, defects were present that will require further assessing and recommendations by a qualified trades persons, please read below for details.

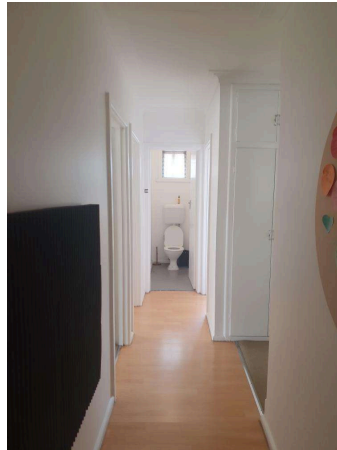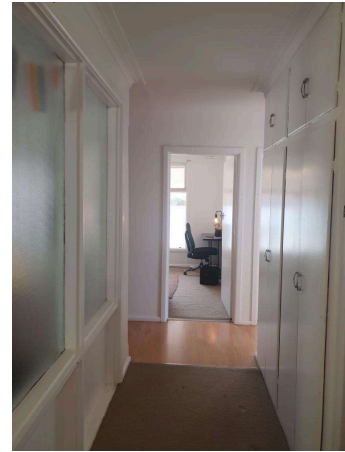

Ceiling

Settlement Cracks Noted. These are typical and generally patch and paint will suffice, however monitoring these cracks is advised for 12 months and if they become worse, further investigation by a suitably qualified professional is advised.



Flooring

Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.



Smoke Alarm

Was a Smoke Alarm Fitted


Yes 2 smoke alarms were sighted but not tested.

Legislation requires smoke Alarms to be installed. Check with your local council regarding type, locations and other related requirements.

Bedroom 1

Overall Condition

On inspection, defects were present that will require further assessing and recommendations by a qualified trades persons, please read below for details.



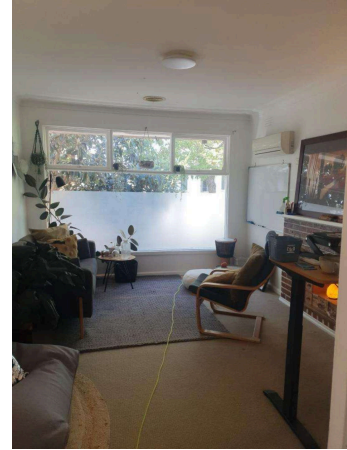


Door

Uneven / out of square door causing binding. A qualified carpenter should be engaged to refit.


Ceiling

Nail popping observed to the ceiling lining. This is should be repaired as soon as possible by a qualified plasterer to avoid any unsafe conditions. Ceiling sagging - Requires immediate repairs to prevent further collapse. Contact a qualified plasterer for repairs.

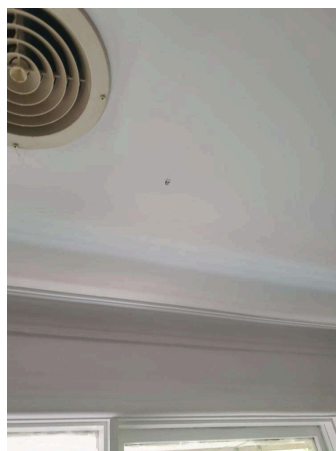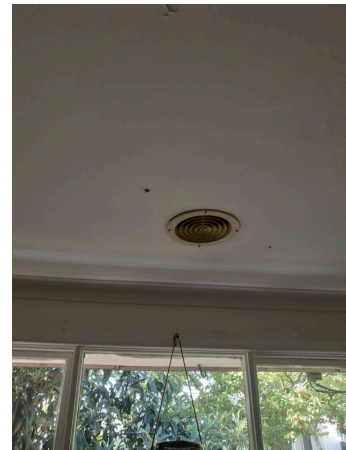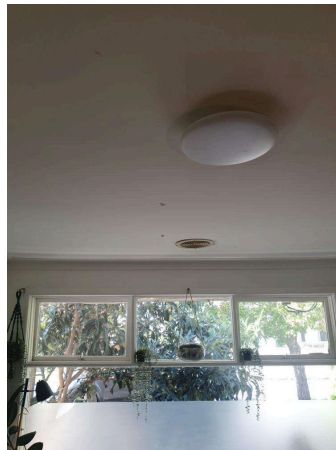


Walls

Settlement Cracks Noted. These are typical and generally patch and paint will suffice, however we recommend monitor these cracks and if become wider or longer, you will need to contact a structural engineers to assess.

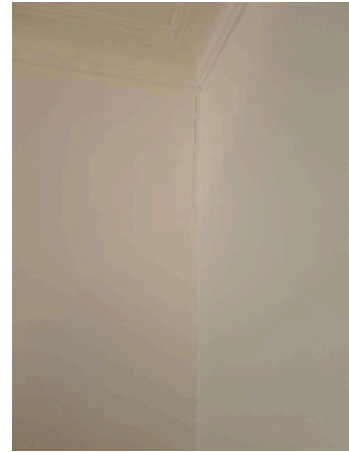


Windows

Movement/settlement/unevenness in frame. A qualified carpenter should be engaged for advice and recommendations.

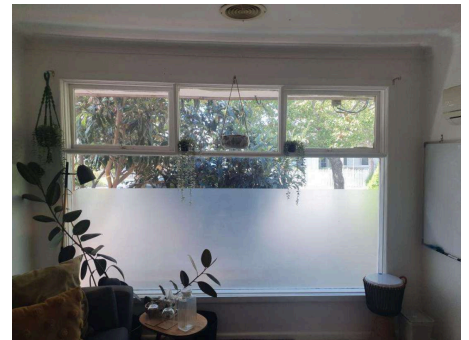

Flooring







Unevenness visible in floor which is generally caused due to by excessive movement/settlement. We recommend that a structural engineer is engaged to assess and rectify.

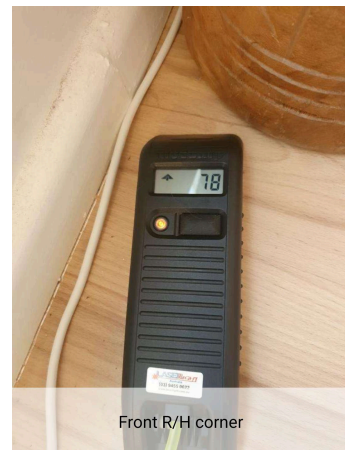

Bedroom 2


Overall Condition

On inspection, defects were present that will require further assessing and recommendations by a qualified trades persons, please read below for details.

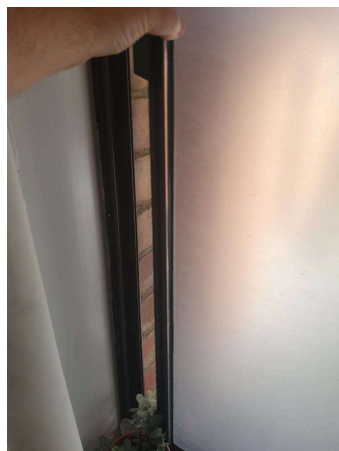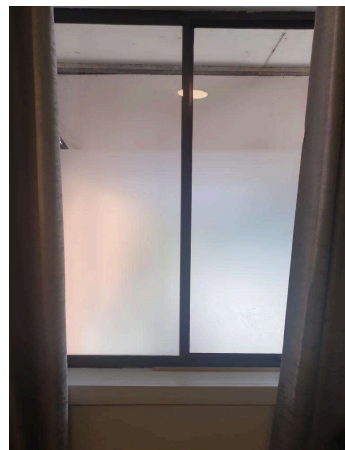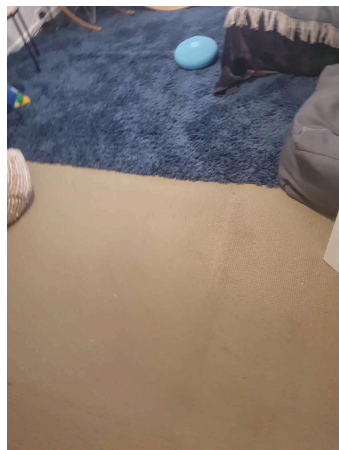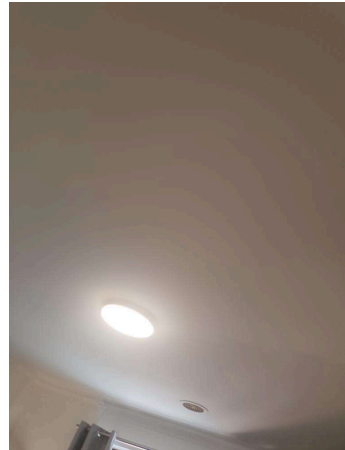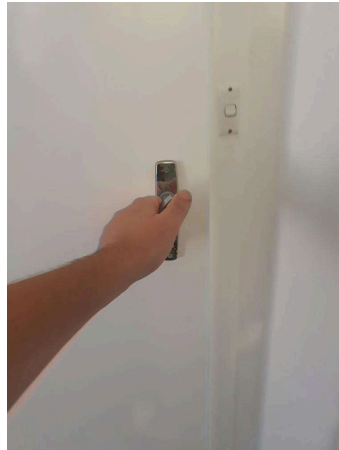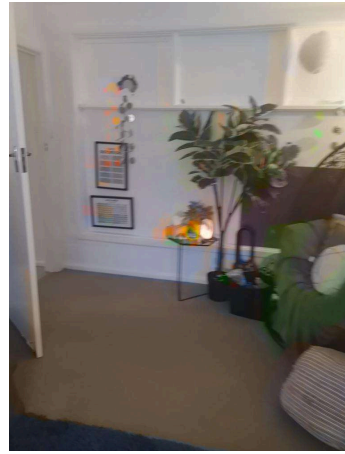

Flooring



Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.

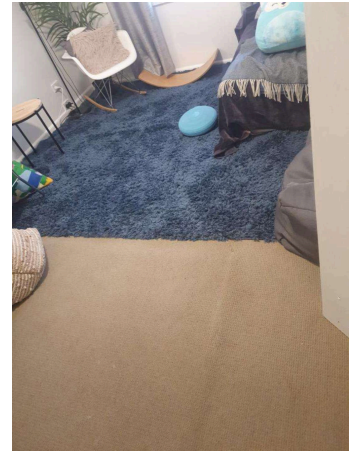

Bedroom 3

Overall Condition

On inspection, defects were present that will require further assessing and recommendations by a qualified trades persons, please read below for details.

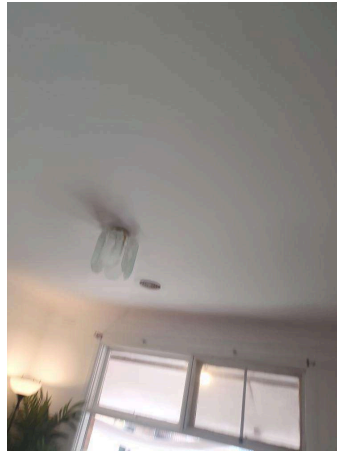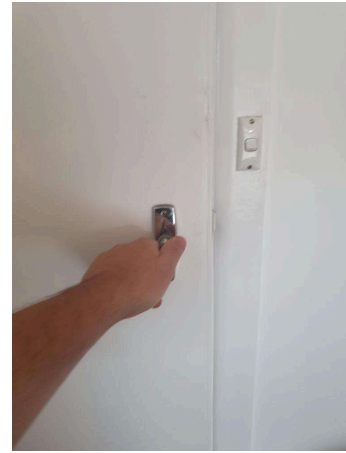







Flooring

Unevenness visible in floor. Possibly due to poor workmanship or excessive movement/settlement. A qualified carpenter should be engaged for advice and recommendations re levelling.

Bedroom 4

Overall Condition

On inspection, defects were present that will require further assessing and recommendations by a qualified trades persons, please read below for details.

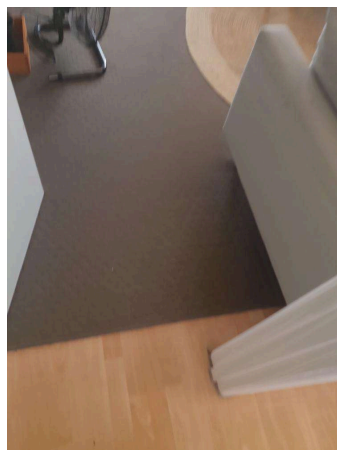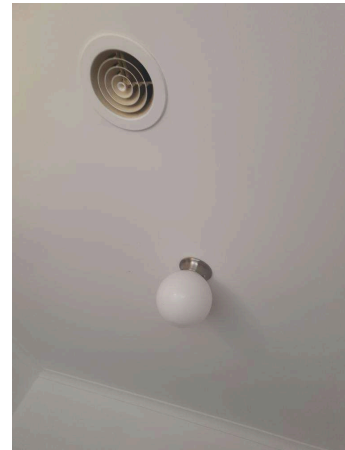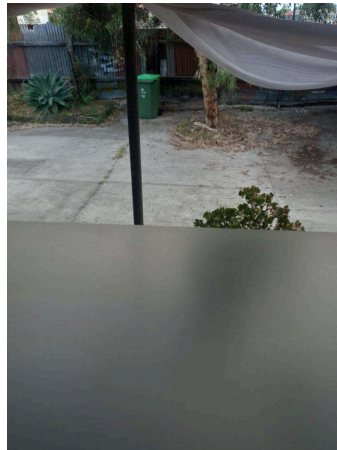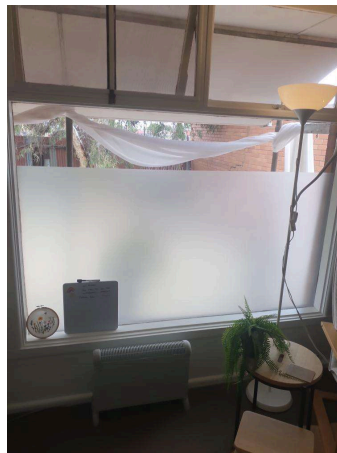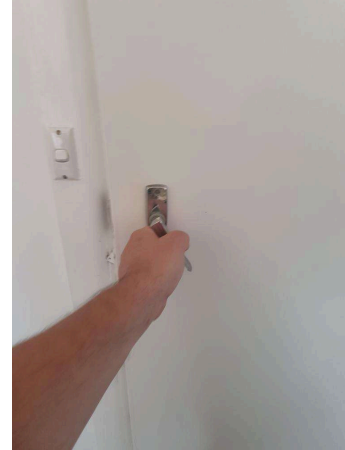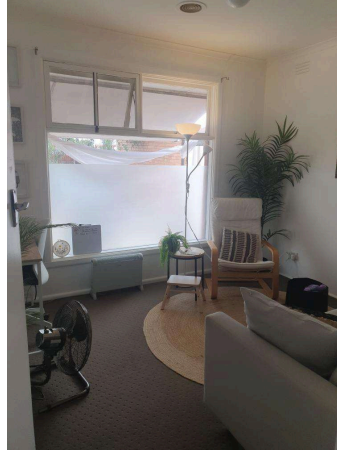

Flooring

Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.

BATHROOM(S)








Powder Room

Location

This bathroom is located in the hallway.


Overall Condition

On inspection, defects were present that will require further assessing and recommendations by licensed and qualified trades persons, please read below for details.

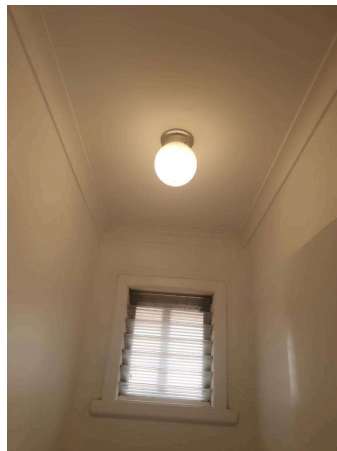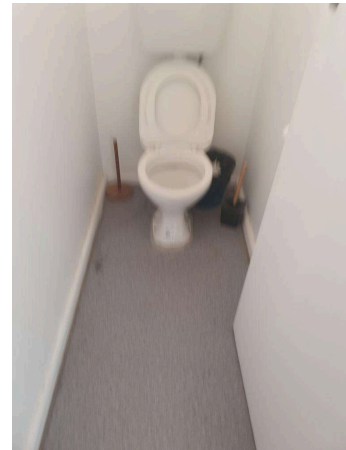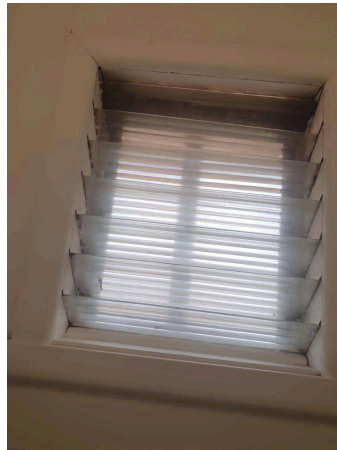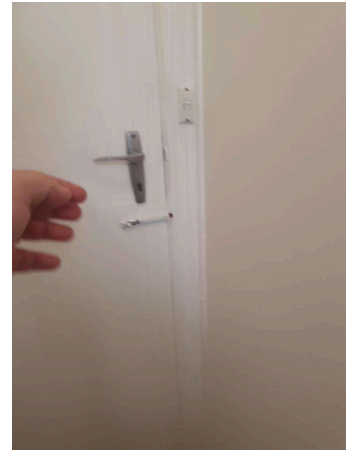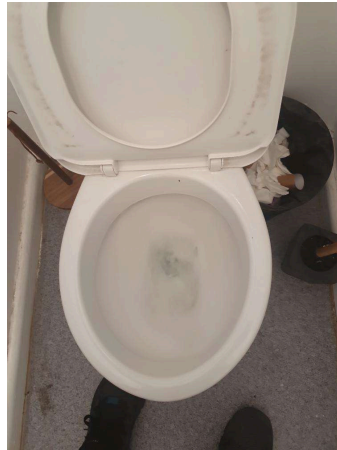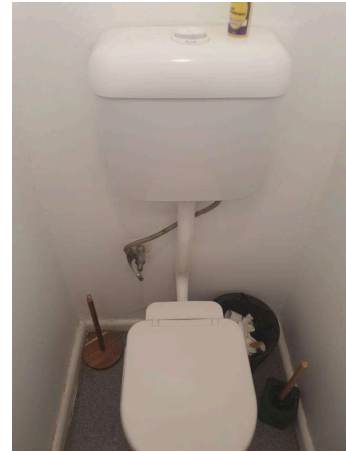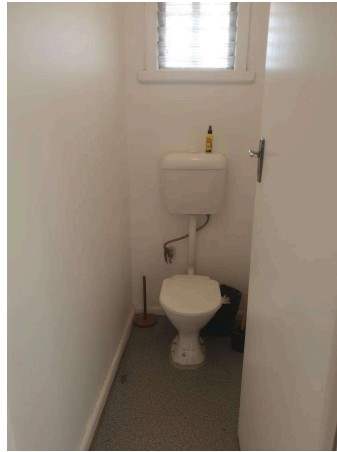

Flooring

Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.

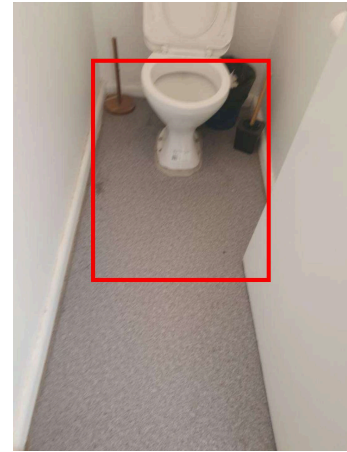




Bathroom 1

Location

This bathroom is located in the hallway.


Overall Condition

On inspection, defects were present that will require further assessing and recommendations by licensed and qualified trades persons, please read below for details.

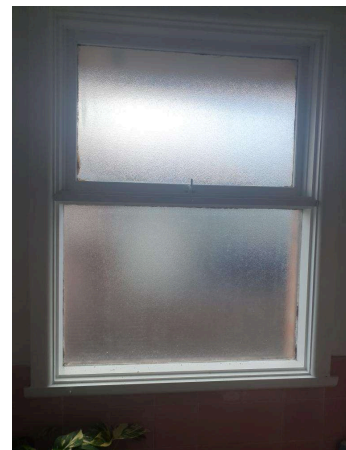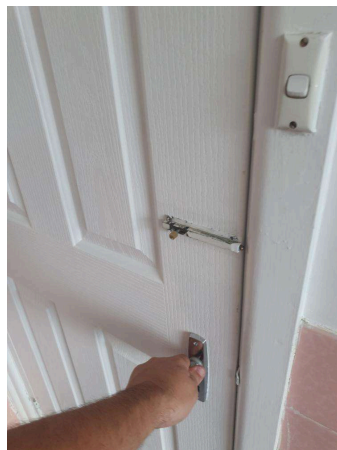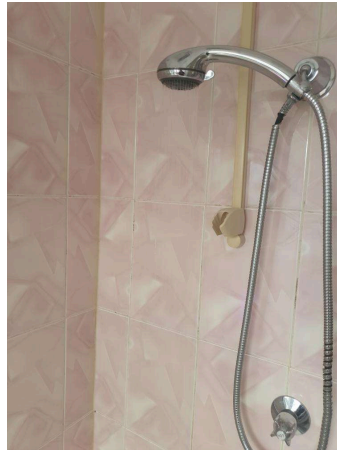



Standard

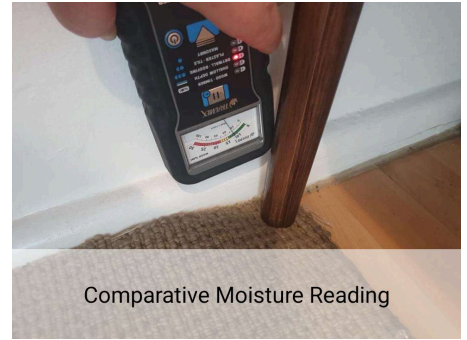


Comparative Moisture Reading



Comparative Moisture Reading


Walls

Settlement Cracks Noted . These are typical and generally patch and paint will suffice, however Monitoring these cracks advised for 12 months and if become wider or longer, you will need to contact a structural engineers to assess.

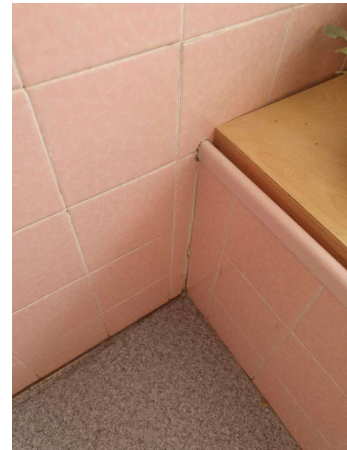

Flooring

Unevenness or unlevel sections visible in floor. Possibly due to poor workmanship or excessive movement/settlement. We recommend that a structural engineer is engaged to access and provide further recommendations.

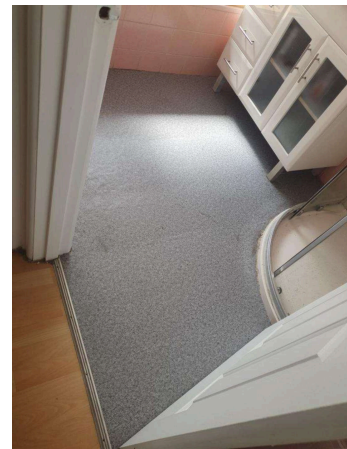

Shower And Bath

Large gaps were present to the shower screen and maintenance or replacement is required. We recommend that a shower screen contractor is engaged to assess and rectify.



Ventilation

Exhaust fan is installed but not operable. A qualified electrician should be engaged for advice and recommendations.

Important Disclaimer





Refer to Section 7 of the Terms And conditions section of this report with regard to all Bathrooms.

KITCHEN & LAUNDRY

Kitchen and Pantry

Overall Condition

Of the visible areas, the general condition of the kitchen and pantry is serviceable or in reasonable condition for age of dwelling.

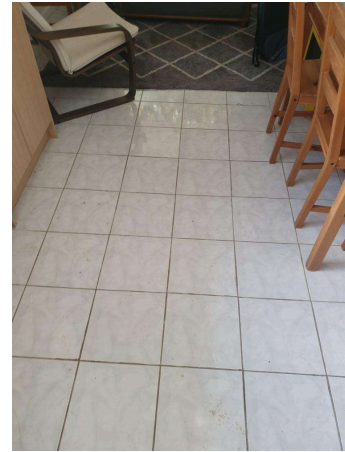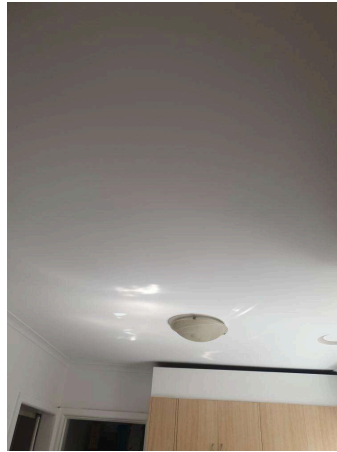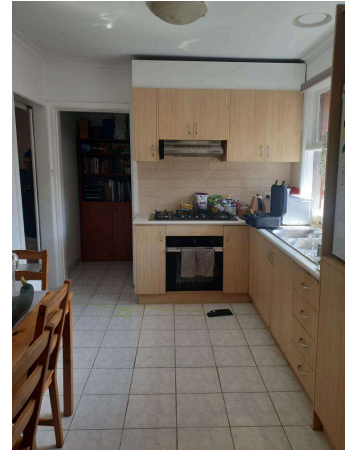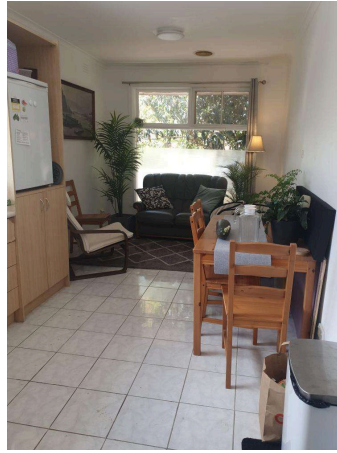


Doors

The area is serviceable with no major defects.






Ceiling

The area is serviceable with no major defects.

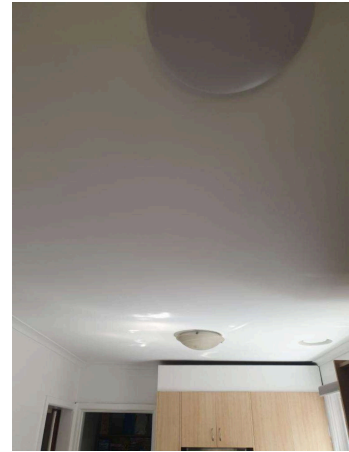



Walls

The area is serviceable with no major defects.

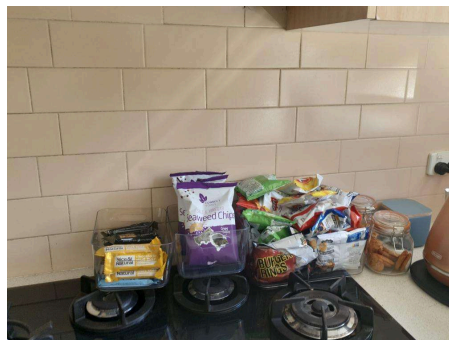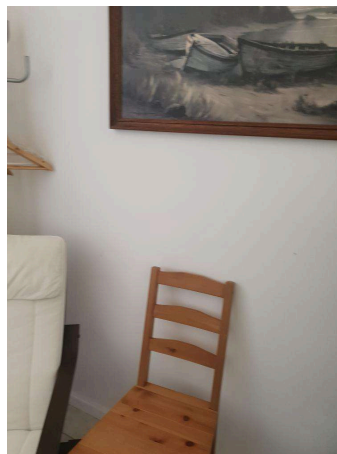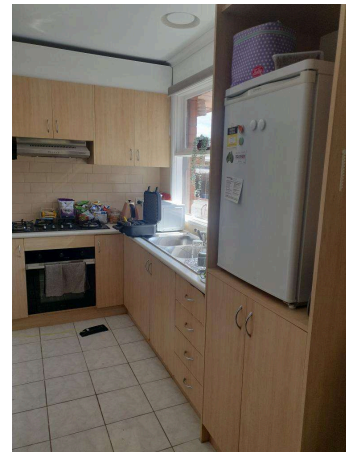



Windows

Binding window/s - This can relate to some differential settlement in the footings, frame movement, age and the like. It can also be seasonal where the windows may bind for some months and then open and close sufficiently. Recommendations: If binding is persistent, a qualified carpenter should be engaged for advice and recommendations.

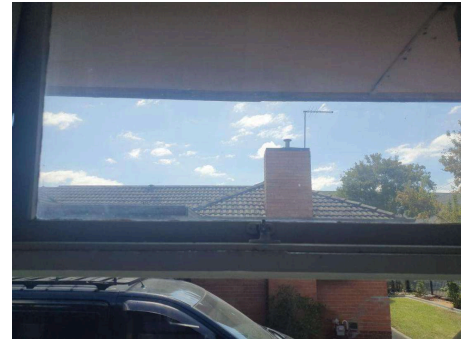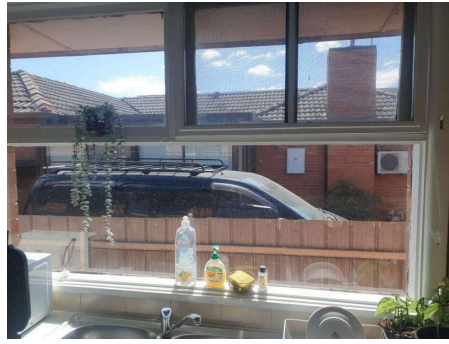

Floor

Cracked floor tiles - Recommendations: A qualified tiler should be engaged for advice and recommendations. This needs to be repaired at the earliest as this has the potential to lead to many related issues such as damp, water ingress to other areas. Unevenness visible in floor which is generally caused due to by excessive movement/settlement. We recommend that a structural engineer is engaged to assess and rectify.

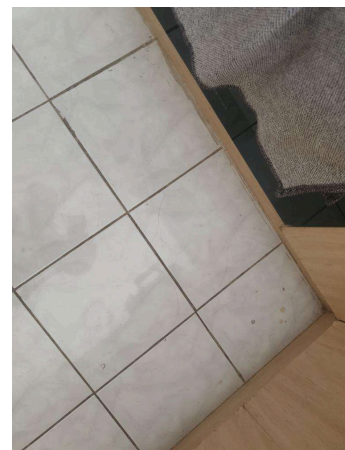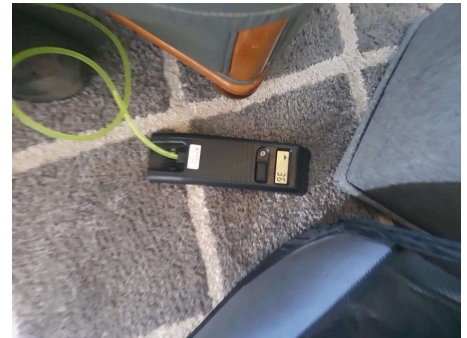





Taps and Sink

The area is serviceable with no major defects.



Cupboards And Bench Tops

Water damage to cabinet observed. Replacement required. Contact a cabinet maker for repairs.

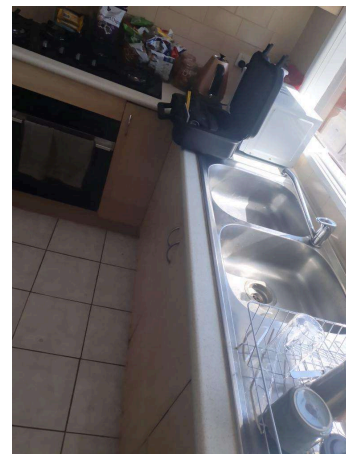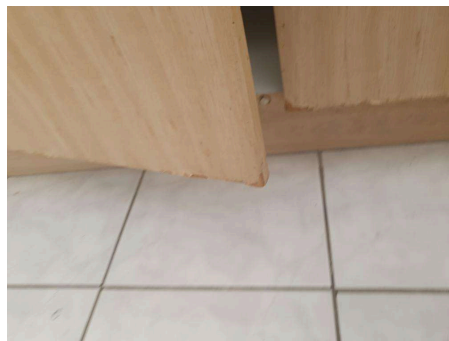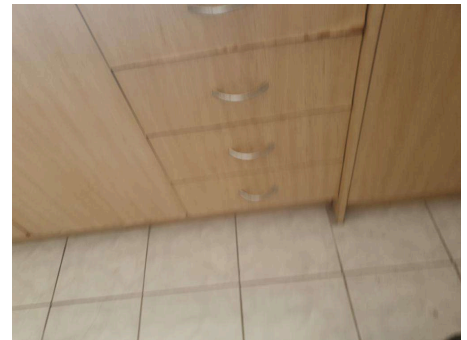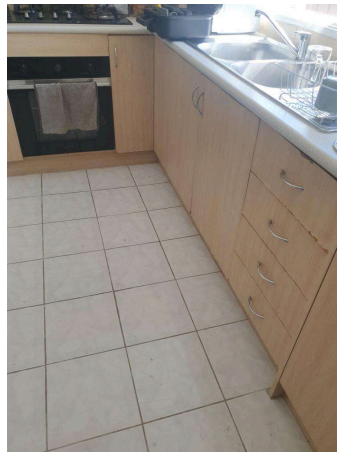


Laundry

General Disclaimer

Laundry appliances are not tested or moved during the inspection and the condition of any walls or flooring hidden by them cannot be judged. Drain lines and water supply valves serving washing machines are not operated.



Restrictions

Appliances and stored goods restricted a full visual inspection.

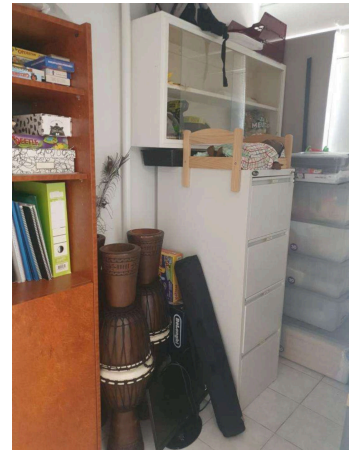



Overall Condition

On inspection, defects were present that will require further assessing and recommendations by licensed and qualified trades persons, please read below for details.

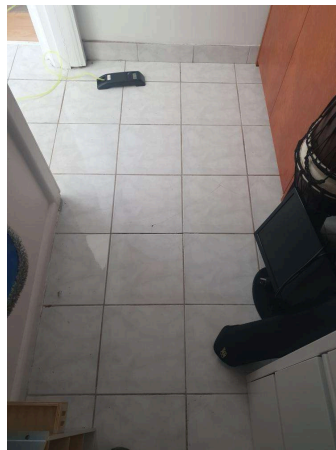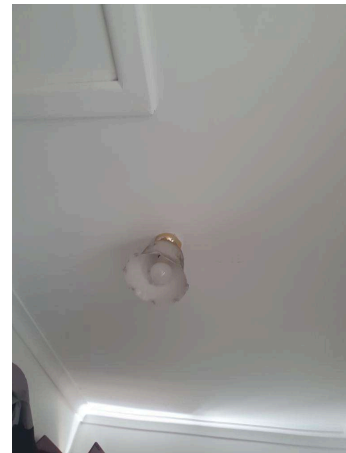

Ceiling

Ceiling paint flake/deterioration is evident. Recommendations: General maintenance / painting as required.

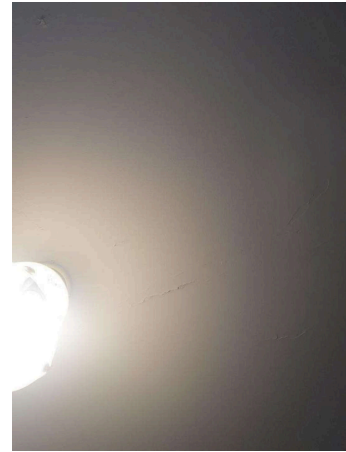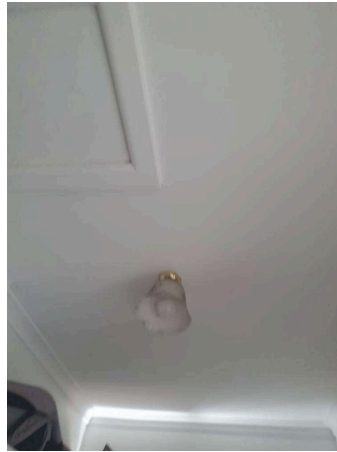

Windows

No access due to stored goods.



Floor

Cracked floor tiles - Recommendations: A qualified tiler should be engaged for advice and recommendations. This needs to be repaired at the earliest as this has the potential to lead to many related issues such as damp, water ingress to other areas. Unevenness visible in floor which is generally caused due to by excessive movement/settlement. We recommend that a structural engineer is engaged to assess and rectify.



ROOF VOID

Roof Void Findings

General Disclaimer

Please refer to section 2B of the Terms And Conditions section of this report.


Restricted Areas

There is insulation present in the roof space/void. This is preventing a full inspection of ceiling joists from being undertaken. It is strongly recommended that full access be gained as it could be harbouring timber pest activity, damage or defects.

Truss Webbing


Hot water storage tank

There is heating and/or cooling system with ducting present in the roof space. This is preventing a full inspection from being undertaken. It is strongly recommended that full access be gained as it could be harbouring timber pest activity, damage or defects.

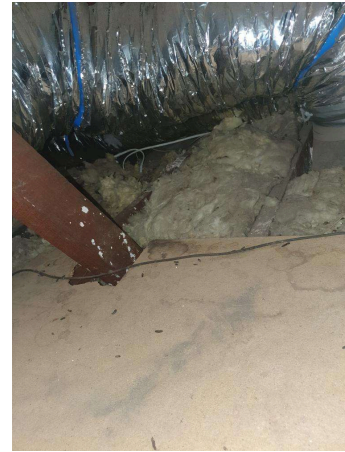

Roof Frame Type

The roof frame is a conventional timber frame.

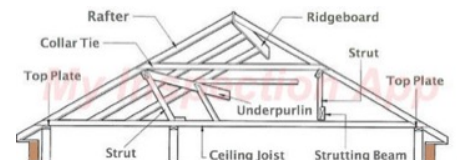


Overall Condition

Defects exist to an area or component/s requiring assessment by a specialized field. Please read below for details.



Roof Cladding

Efflorescence observed indicating water absorption. White stains on tile roofs are typically an efflorescence deposit and may indicate that the tile is absorbing water, thus nearing end of life. A qualified roof restorer/tiler should be engaged for advice and recommendations.

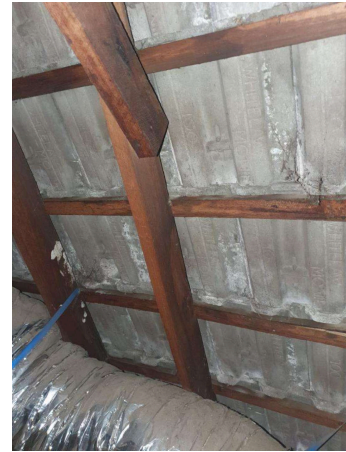

Insulation

Type

The roof space is insulated with fibreglass batts.

Condition

Where visible and accessible, the insulation appears to be in a serviceable condition.

Sarking


sarking is not Installed.

SUBFLOOR

Access and Restrictions

Restricted Areas

Inspection could not be conducted as there was no access to the subfloor. An invasive inspection of the area is required.

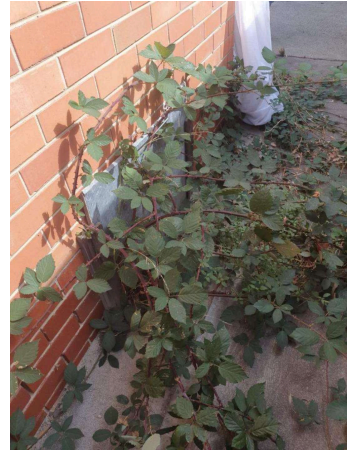

CONCLUSION

Condition Of Inspected Structure

Overall Condition

The overall condition of this building has been compared to similar constructed buildings of approximately the same age where those buildings have had a maintenance program implemented to ensure that the building members are still fit for purpose.

The summary lists of Major and Minor defects included this report are the opinion of the inspector, other inspectors or individuals may have a different opinion to what is a Minor or a Major Defect. The incidence of major and minor defects and overall condition in this residential building as compared with similar buildings is listed below.

section of this report for definition.

General Maintenance and Upkeep of This Property

The general maintenance and upkeep of this property is considered: **BELOW AVERAGE**

The incidence of Major Defects

The incidence of major defects in this residential building as compared with similar buildings is considered **HIGH**

The Incidence of Minor Defects

The incidence of minor defects in this residential building as compared with similar buildings is considered **TYPICAL**

The Overall Condition Of This Dwelling

The overall condition of this residential dwelling in the context of its age, type and general expectations of similar properties is **AVERAGE TO ABOVE AVERAGE**



PROPERTY AND INSPECTION INFORMATION

Weather at Inspection Area

Weather Conditions

The weather was fine and dry at the time of the inspection.

Property Information

Building Type

The structure is a residential house.

Construction Type

The structure is of brick veneer construction.

BRICK VENEER WALL



Roof Cladding

Tile roofing.

Roof Design

The roof is a pitched roof design.

Footings Type

Suspended floor frame but no access to ascertain type.

Storeys

Single level dwelling.

Property Occupied

The property was occupied.

Property Furnished

The property was excessively furnished or had excessive storage of goods. Due to the amount of furnishings, belongings, further defects may be present that were not visible at the time of inspection. We recommend that a follow-up inspection is undertaken on removal of the goods.

People Present

The estate agent was present.

The tenant/s were present.

The Client was present.

Access and Restrictions

Inspected Areas

Building exterior.

Building interior.

The garage.

Roof Exterior
The Roof void.

The site.

Area Where Inspection Was Restricted

Stored items on the exterior walls restricted full visual inspection of the building's exterior.

Furniture and belongings restricted full visual inspection of the building interior.

Storage/Vehicles restricted full visual inspection on the garage.

Clearances, ducting and insulation where applicable restricted full visual inspection of the roof void.

Height restrictions, and or safety concerns restricted full and visual inspection of the roof exterior.

Excess vegetation and growth restricted full visual inspection of the site.

Areas Not Inspected

The sub-floor.

Inaccessible roof void sections due to access limitations and or insulation and ducting.
Timber frame and concealed timbers behind cladding/wall lining.

Sections of the roof exterior were inaccessible and unable to be inspected.

Areas where the building is built on the boundary.

Utility Status

Water

The water was Connected. All plumbing pipe installation should be assessed by a licensed plumber.

Electricity

Electricity to the dwelling was connected. Note: We do not carry out electrical inspections for wiring or safety. This must be carried out by a licensed electrician and I recommend you have all electrical wiring and components assessed by a licensed electrician.

Apparent Concealment of possible defects

Were apparent Concealments seen

No apparent concealing of defects was visible.

inspection Agreement

Were there any specific requirements to The Pre Inspection Agreement

No specific requirements to the inspection or Pre inspection agreement were requested by the client or their legal representatives.

TERMS AND CONDITIONS

The purpose of the inspection is to identify the major defects and safety hazards associated with the property at the time of the inspection. The inspection and reporting is limited to a visual assessment of structure in accord with AS 4349.1 appendix "C" or if not a pre-purchase report then the report complies with AS4349.0. This is a general appraisal only and cannot be relied on its own, a further inspection by specialist and qualified trades is strongly recommended.

NOT A PEST REPORT: This inspection and report will not inspect, seek or attempt to identify timber pest activity or damage. We strongly recommend you obtain a timber pest inspection conducted by a licensed and suitably qualified pest inspector.

DEFINITIONS AND TERMINOLOGY

SERVICEABLE: The building material or component is in reasonable or serviceable condition for the age of the dwelling.

TRADESMAN: A defect or a number of defects were visible that will require assessment by a qualified trades person.

AGE: The component has deterioration due to ageing or lack of upkeep and or maintenance.

MONITOR: Some defects may require monitoring to ascertain if the defect will worsen, reappear or cause further problems.

STRATA: In the case of strata and company title properties, the inspection is limited to the interior and immediate exterior of the particular unit being inspected report.

HIGH: The frequency and/or magnitude of defects are beyond the inspectors expectations when compared to similar buildings of approximately the same age that have been reasonably well maintained.

TYPICAL: The frequency and/or magnitude of defects are consistent with the inspectors expectations when compared to similar buildings of approximately the same age which have been reasonably well maintained.

LOW: The frequency and/or magnitude of defects are lower than the inspectors expectations when compared to similar buildings of approximately the same age that have been reasonably well maintained.

ABOVE AVERAGE: The overall condition is above that consistent with dwellings of approximately the same age and construction. Most items and areas are well maintained and show a reasonable standard of workmanship when compared with buildings of similar age and construction.

AVERAGE: The overall condition is consistent with dwellings of approximately the same age and construction. There will be areas or items requiring some repair or maintenance.

BELOW AVERAGE: The building and its parts show some significant defects and/or very poor non- tradesman like workmanship and/or long-term neglect and/or defects requiring major repairs or reconstruction of major building.

SIGNIFICANT ITEMS: An item that must be reported in accordance with the scope of the inspection.

MAJOR DEFECT: A defect of sufficient magnitude requiring building works to avoid unsafe conditions, loss of function or further worsening of the defective item.

MINOR DEFECT: Any defect other than what is described as a Significant Item or major defect.

SAFETY HAZARD: A defect that presents unsafe conditions and must be reported as a Major defect.

ACCESSIBLE AREA: Is any area of the property and structures allowing the inspector safe and reasonable access within the scope of the inspection.

LIMITATION: A factor that prevents full or proper inspection of the building.

IMPORTANT INFORMATION

Important information regarding the scope and limitations of the inspection and this report. Any

person who relies upon the contents of this report does so acknowledging that the following clauses, which define the scope and limitations of the inspection, form an integral part of the report. The inspection comprised a visual assessment of the property to identify major defects and to form an opinion regarding the general condition of the property at the time and date of the visual inspection. An estimate of the cost of rectification of defects is outside the scope of Australian Standard AS 4349 and does not form part of this report. If the property inspected is part of a Strata or Company Title, then the inspection is limited to the interior and the immediate exterior of that particular residential dwelling. The inspection does not cover common property. This report and any other attached report should not be relied upon if the contract for sale becomes binding more than 30 days after the date of initial inspection. A re- inspection after this time is essential. Further, this report is not intended to be used as a marketing tool by and real-estate agents and only the person named in the **CLIENT INFORMATION** section of the report shall this report apply to as it is assumed and agreed that the person who orders the report is indeed the person purchasing the property inspected. Where a report is ordered on behalf of a **CLIENT** it is assumed that the terms and condition and Pre Inspection Agreement have been fully explained to the **CLIENT** by the person or company ordering the report.

We strongly advise that any cracking reported in this report should be referred to a structural engineer for further assessment and advice. Please refer to Cracking Of Building Elements in section 2G of these Terms And Condition

Acceptance Criteria: The building shall be compared with a building that was constructed in accordance with the generally accepted practice at the time of construction and which has been maintained such that there has been no significant loss of strength and serviceability.

Limitations: This report is limited to a visual inspection of areas where safe and reasonable access is available and access permitted on the date and at the time of inspection. The Inspection will be carried out in accordance with AS4349.1-2007. The purpose of the inspection is to provide advice to a prospective purchaser regarding the condition of the property at the date and time of inspection. Areas for Inspection shall cover all safe and accessible areas. It does not purport to be geological as to foundation integrity or soil conditions, engineering as to structural, nor does it cover the condition of electrical, plumbing, gas or motorised appliances. It is strongly recommended that an appropriately qualified contractor check these services prior to purchase. As a matter of course, and in the interests of safety, all prospective purchasers should have an electrical report carried out by a suitably qualified contractor. This report is limited to (unless otherwise noted) the main structure on the site and any other building, structure or outbuilding within 30m of the main structure and within the site boundaries including fences.

Safe and Reasonable Access: Only areas to which safe and reasonable access is available were inspected. The Australian Standard AS4349.1 or AS4349.0 defines reasonable access as "areas where safe, unobstructed access " is provided and the minimum clearances specified below are available, or where these clearances are not available, areas within the inspectors unobstructed line of sight and within arms length. Reasonable access does not include removing screws and bolts to access covers. Reasonable access does not include the use of destructive or invasive inspection methods and does not include cutting or making access traps or moving heavy furniture, floor coverings or stored goods.

Roof Interior- Access opening 400 x 500 mm - Crawl Space 600 x 600mm - Height accessible from a 3.6m ladder.

Roof Exterior- Must be accessible from a 3.6m ladder placed on the ground.

1) NOT A CERTIFICATE OF COMPLIANCE: This report is not an all-encompassing report dealing with the building from every aspect. It is a reasonable attempt to identify any obvious or significant defects apparent at the time of the inspection. Whether or not, a defect is considered significant or not depends too a large extent, upon the age and type of the building inspected. This report is not a certificate of compliance with the requirements of any act, regulation, ordinance or by-law. It is not a structural report. Should you require any advice of a structural nature you should contact a structural engineer.

2) VISUAL INSPECTION: This is a visual inspection only limited to those areas and sections of the

property safe that are fully accessible safe to access and visible to the inspector on the date of inspection.

2A) Please refer to each individual area regarding sections that were incapable or being inspected. Please acknowledge the following. Where a complete inspection of some areas listed through the report may not have been physically possible (due to but not limited to storage, furniture, beds, personal belongings in cupboards and/or wardrobes, the 2nd storey roofing, gutters, fascia, flashings and the like, low clearance in sub-floor or roof void areas, ducts and deep insulation restricting access in roof voids, sub-floor restrictions including plumbing, ducts, low clearance, no access doors or access doors too small and the like) then it follows that defects, timber pest activity and/or damage may exist in these areas. To adequately inspect these restricted areas, ducts and floor boards may need to be removed, furniture moved, cupboards and wardrobes emptied which will be difficult to carry out. This will obviously be difficult to carry out due to time restrictions and permission would need to be obtained from the property owner.

This Firm **DOES NOT GUARANTEE IN ANY WAY** that there **ARE OR ARE NOT** any defects, termite damage or live termites in any areas not inspected. To obtain a full understanding of the report findings, it is essential you read the entire inspection report, including the information sections at the end of this report and I encourage you to call me if you have any queries at all before purchasing.

2B) Entering attics or roof voids that are insulated can cause damage to the insulation and attic framing. Attics with deep insulation cannot be safely inspected due to limited visibility of the framing members upon which the inspector must walk. In such cases, the attic is only partially accessed, thereby limiting the review of the attic area from the hatch area only. Inspectors will not crawl the attic area when they believe it is a danger to them or that they might damage the attic insulation or framing. There is a limited review of the attic area viewed from the hatch only in these circumstances.

2C) The roof covering will not be walked upon if in the opinion of the inspector it is not safe to do so. Generally issues that prevent roof access include, access height over 3 metres, steep pitch, wet/slippery surfaces, deteriorated covering. Not being able to walk a roof significantly limits our inspection, which can result in hidden defects going undetected. The overall condition of the roofing and its components is an opinion of the general quality and condition of the roofing material. The inspector cannot and does not offer an opinion or warranty as to whether the roof leaks or may be subject to future leakage. This report is issued in consideration of the foregoing disclaimer. The only way to determine whether a roof is absolutely watertight is to observe it during a prolonged rainfall. Many times, this situation is not present during the inspection. We offer no guarantee that the roof cladding or roof components such as flashing will not leak in the future.

2D) Limitations to the exterior inspection this is a visual inspection limited in scope by (but not restricted to) the following conditions: A representative sample of exterior components was inspected rather than every occurrence of components. The inspection does not include an assessment of geological, geotechnical, or hydrological conditions, or environmental hazards. Screening, shutters, awnings, or similar seasonal accessories, fences, recreational facilities, outbuildings, seawalls, break-walls, docks, erosion control and earth stabilization measures are not inspected unless specifically agreed-upon and documented in this report. Please note. If any wall cracking/cracks/openings are found at this dwelling, we cannot offer any guarantee that any visible wall cracks will not widen or lengthen over time or in the future as this is impossible to predict. We strongly recommend you contact a practicing structural engineer for further advice.

2E) Timber framed windows can bind or stick. This can be seasonal due to the fluctuation in moisture content in timber. If binding or sticking continues a carpenter may require adjustments. Binding windows is not normally a major defect, however in some circumstances binding windows and doors can be directly related to some differential footings settlement. If any timber fungal decay on frames or deteriorated putty seals is noted, the consultant will not attempt to operate windows due to potential damage. Windows that are sticking, binding or paint stuck will also not be forced open. Water leaks to windows and surrounds cannot be determined in the absence of rain.

2F) Internal Inspections. Carpets and or other floor coverings, cupboards/cabinets, joinery, finishes

and fittings, normally obstruct inspection to the upper-side of flooring. Defects or timber pest damage may be present and not detected in areas where inspection was limited, obstructed or access was not gained. The condition of walls behind wall coverings, panelling and furnishings cannot be inspected or reported on. Only the general condition of visible areas is included in this inspection. Where fitted. Wood burning and other forms of fireboxes are outside the scope of this inspection. We recommend you have these tested prior to purchase for peace of mind.

2G) Cracking of Building Elements: Regardless of the type of crack(s) the inspector carrying out a visual inspection is unable to determine the expected consequences of the cracks. As a crack on the day can be 1mm wide but may have the potential to develop over time into structural problems for the home owner resulting in major expensive rectification work.

Information required to determine the consequences of a crack:

Nature of the foundation material on which the building is resting

- a) The design of the footings
- b) The site landscape and topography
- c) The history of the cracks

All these factors fall outside the scope of this inspection. However the information obtained from the items above are valuable in determining the expected consequences of the cracking and any remedial work.

Cracking Categories:

Cracking is also categorized into the following 5 categories with a description of typical damage and required repairs:

0-Hairline cracking, less than 0.1mm,

1-Fine cracks that do not need repair, less than 1.0mm,

2-Noticeable cracks, yet easily filled 1mm - 5.0mm,

3-Cracks that can be repaired and possibly some of the wall sections will need to be replaced.

Weather tightness can be impaired, 5.0mm -15.0mm,

4-Extensive repair works required involving breaking out and replacing these sections. Walls can become out of plumb and fall and causes reduced bearing capacity, 15.0mm - 25.0mm.

IMPORTANT: Regardless of location or size If cracks have been identified then a structural engineer is required to determine the significance of the cracking prior to a decision to purchase.

2H) Important Note: Where any elevated structure (deck, balcony, veranda etc.) is present, and this elevated structure is designed to accommodate people, you must have this structure checked by an engineer or other suitably qualified person. You should also arrange annual inspections of the structure by an engineer or other suitably qualified person to ensure any maintenance that may become necessary is identified. Care must be taken not to overload the structure. Nothing contained in this inspection should be taken as an indicator that we have assessed any elevated structure as suitable for any specific number of people or purpose. A qualified engineer can only do this. For the purpose of this report, the structure includes elevated decks; verandas, pergolas, balconies, handrails, stairs and childrens play areas. Where any structural component is concealed by lining materials or other obstructions, these linings or obstructions must be removed to enable an evaluation to be carried out by an appropriately qualified person.

3) CONCEALED DEFECTS: This report does not and cannot make comment upon: Defects that may have been concealed the assessment or detection of defects (including rising damp and leaks) which may be subject to the prevailing weather conditions whether or not services have been used for some time prior to the inspection and whether this will affect the detection of leaks or other defects e.g. In the case of shower enclosures and bath tubs, the absence of any leaks or dampness at the time of the inspection does not necessarily mean that the enclosure will not leak after use) the presence or absence of timber pests; gas-fittings; common property areas; environmental concerns; the proximity of the property to flight paths, railways, or busy traffic; noise levels; health and safety issues; heritage concerns; security concerns; fire protection; site drainage (apart from surface water drainage); swimming pools and spas (non-structural); detection and identification of illegal building work; detection and identification of illegal plumbing work; durability of exposed finishes; neighbourhood problems; document analysis; electrical installation; any

matters that are solely regulated by statute; any area(s) or item(s) that could not be inspected by the consultant.

4) NO GUARANTEE: Accordingly this report is not a guarantee that defects and/or damage do not exist in any inaccessible or partly inaccessible areas or sections of the property. Such matters may upon request be covered under the terms of a special purpose property report.

5) SWIMMING POOLS: Swimming pools/spas are not part of the standard building report under as4349.1-2007 and are not covered by this report. We strongly recommend a pool expert should be consulted to examine the pool and the pool equipment and plumbing as well as the requirements to meet the standard for pool fencing. Failure to conduct this inspection and put into place the necessary recommendations could result in finds for non-compliance under the legislation.

6) SURFACE WATER AND DRAINAGE: The retention of water from surface run off could have an effect on the foundation material which in turn could affect the footings to the house. Have water directed away from the house or to storm water pipes by a licensed drainage plumber. The general adequacy of site drainage is not included in the standard property inspection report. Comments on surface water drainage are limited as where there has been either little or no rainfall for a period of time; surface water drainage may appear to be adequate but then during periods of heavy rain, may be found to be inadequate. Any comments made in this report are relevant only to the conditions present at the time of inspection. It is recommended that a smoke test be obtained to determine any illegal connections, blocked or broken drains.

7) SHOWER RECESSES: All Shower areas are visually checked for leakage, but leaks often do not show except when the shower is in actual long-term use. Determining whether shower areas, bath/shower surrounds are watertight is beyond the scope of this inspection. It is very important to maintain adequate sealing in the bath areas. Very minor imperfections can allow water to get into the wall or floor areas and cause damage. Adequate and proper ongoing maintenance will be required in the future. Tests may be made on shower recesses to detect leaks (if water is connected). The tests may not reveal leaks or show incorrect waterproofing if silicone liquid or masonry sealant has been applied prior to the inspection. Such application is a temporary waterproofing measure and may last for some months before breaking down. The tests on the shower recesses are limited to running water within the recesses and visually checking for leaks as showers are only checked for a short period of time, prolonged use may reveal leaks that were not detected at the time of inspection. No evidence of a current leak during inspection does not necessarily mean that the shower does not leak.

8) GLASS CAUTION: Glazing in older houses (built before 1978) may not necessarily comply with current glass safety standards AS1288. In the interests of safety, glass panes in doors and windows especially in traffic-able areas should be replaced with safety glass or have shatterproof film installed unless they already comply with the current standard.

9) STAIRS AND BALUSTRADES: Specifications have been laid down by the National Construction Code Section 3.9 covering stairs, landings, balustrades to ensure the safety of all occupants and visitors in a building. Many balustrades and stairs built before 1996 may not comply with the current standard. You must upgrade all such items to the current standard to improve safety.

10) RETAINING WALLS: Where retaining walls are more than 700mm high these wall/s should have been installed with engineering design and supervision. Walls found on the site were not assessed and the performance of these walls is not the subject of a standard property report and should be further investigated with regard to the following items, adequate drainage systems, adequate load bearing, correct component sizing and batter.

11) ROOMS BELOW GROUND LEVEL: If there are any rooms under the house or below ground level (whether they be habitable or non-habitable rooms), these may be subject to dampness and water penetration. Drains are not always installed correctly or could be blocked. It is common to have damp problems and water entry into these types of rooms, especially during periods of heavy rainfall and this may not be evident upon initial inspection. These rooms may not have council approval. The purchaser should make his or her own enquiries with the Council to ascertain if

approval was given.

12) ASBESTOS DISCLAIMER: No inspection for asbestos was carried out at the property and no report on the presence or absence of asbestos is provided.

13) MOULD (mildew and non-wood decay fungi) disclaimer: Mildew and non-wood decay fungi is commonly known as mould. However, mould and their spores may cause health problems or allergic reactions such as asthma and dermatitis in some people. No inspection for mould was carried out at the property and no report on the presence or absence of mould is provided.

14) MAGNESITE DISCLAIMER: No inspection for Magnesite flooring was carried out at the property and no report on the presence or absence of Magnesite flooring is provided. You should ask the owner whether Magnesite flooring is present and/or seek advice from a structural engineer.

15) ESTIMATING DISCLAIMER: No estimate is provided in this report. We strongly recommend you obtain quotes for repairs from licensed tradesman prior to a decision to purchase.

16) DISCLAIMER OF LIABILITY: No liability shall be accepted on an account of failure of the report to notify any problems in the area(s) or section(s) of the subject property physically inaccessible for inspection, or to which access for inspection is denied by or to the inspector (including but not limited to or any area(s) or section(s) so specified by the report) Compensation will only be payable for losses arising in contract or tort sustained by the client named on the front of this report. Compensation is limited to the price of the report initially paid by the claimant named in the report as the "CLIENT"

17) DISCLAIMER OF LIABILITY TO THIRD PARTIES: Compensation will only be payable for losses arising in contract or tort sustained by the Client named on the front of this report. Any third party acting or relying on this Report, in whole or in part, does so entirely at his or her own risk.

18) COMPLAINTS PROCEDURE: In the event of any dispute or claim arising out of, or relating to the Inspection or the Report, You must notify Us as soon as possible of the dispute or claim by email, fax or mail. You must allow Us (which includes persons nominated by Us) to visit the property (which visit must occur within twenty eight (28) days of your notification to Us) and give Us full access in order that We may fully investigate the complaint. You will be provided with a written response to your dispute or claim within twenty eight (28) days of the date of the inspection. If You are not satisfied with our response You must within twenty one (21) days of Your receipt of Our written response refer the matter to a Mediator nominated by Us from the Institute of Arbitrators and Mediators of Australia. The cost of the Mediator will be borne equally by both parties or as agreed as part of the mediated settlement.

In the event You do not comply with the above Complaints Procedure and commence litigation against Us then You agree to fully indemnify Us against any awards, costs, legal fees and expenses incurred by Us in having your litigation set aside or adjourned to permit the foregoing Complaints Procedure to complete.

OTHER RECOMMENDED INSPECTIONS

Electrical installation: All electrical wiring, meter-box and appliances need to be checked by a qualified electrician. The inspection of any electrical item is outside the scope of this report.

Plumbing: All plumbing including septic tanks need to be inspected and reported on by a plumber.

Hot water service: Hot water services need to be checked by a plumber and/or electrician.

Gas: All gas services need to be inspected and reported on by a gas plumber.

Phone: All phones, phone lines and outlets need to be inspected and reported on by a telecommunications technician.

Smoke Alarm: Australian standard AS3786 advises that smoke alarms are required for all buildings where people sleep. It is recommended that an electrician be consulted to give advice on those installed or to install smoke alarms.

Trees: Where trees are too close to the house this could affect the performance of the footing as the moisture levels change in the ground.

Contact the inspector: Please feel free to contact the inspector who carried out this inspection. Often it is very difficult to fully explain situations, problems, access difficulties, building faults or their importance in a manner that is readily understandable by the reader. Should you have any

difficulty in understanding anything contained within this report then you should immediately contact the inspector and have the matter explained to you. If you have any questions at all or require any clarification then contact the inspector prior to acting on this report.

TIMBER PEST INSPECTION

Please note that this inspection and report was a Visual only inspection to the readily accessible areas of the property as defined within the terms and conditions of this report.

Please ensure that you read all sections of the report as well as the additional information at the rear of Please note that this inspection and report was a Visual only inspection to the readily accessible areas of the property as defined within the terms and conditions of this report. As this is a visual inspection only there may be damage to structural timbers within the building from termite infestation that is concealed by wall/s and or ceiling linings, and that such damage has neither been inspected for nor reported herein. Please ensure that you read all sections of the report as well as the additional information at the rear of the report and understand the limitations and the special recommendations for this construction style. If there is something you do not understand or require further clarification. Please contact the Inspector. **IMPORTANT: The Client acknowledges that, unless stated otherwise, the Client, as a matter of urgency should implement any recommendation or advice given in this report. Please contact the inspector If there is something you do not understand or require further clarification on.**

ACCESS AND RESTRICTIONS

Note

Inspection Information

For the purpose of visual timber pest inspection this timber pest inspection report which form part of a combined timber pest and building inspection. The inspection information listed at the beginning of the building inspection report namely report information shall apply. Including the date and time of inspection, agreement number, who the report is prepared for and the description of the property inspected. **THIS IS A VISUAL INSPECTION ONLY** in accord with the requirements of AS4349.3-2010 - Inspection of buildings Part 3: Timber Pest Inspections.

Summary Only

Important Disclaimer

Important disclaimer: This summary and the opinion are supplied to allow a quick and superficial overview of the inspection results. This summary is not the report and cannot be relied upon on its own. This summary must be read in conjunction with the full report and not in isolation from the report. If there should happen to be any discrepancy between anything in the report and anything in this summary, the information in the report shall override that in this summary. The report is subject to terms and limitations. Note: It is essential that you read the entire report; other inspectors may have and are entitled to different opinions in relation to this dwelling. Note: This report should not be relied upon if the contract for sale becomes binding more than 30 days after the date of initial inspection. A re-inspection after this time is essential.

1.1 Access to Areas

Areas where Access Should be Gained

Yes. Please read the report in its entirety

1.2 Timber Pest Activity

Was there any Termite Workings or Damage Found

No: Of the areas able to be inspected there were no termite workings or termite damage visible. Please read this report in its entirety.

Were Any Live or Active Termites Found

No: Please read this report in its entirety

NOTE

Note: Any evidence of termite activity or workings in the grounds or building structure assumes that the risk to buildings is extremely high. We strongly recommend a treatment to eradicate the termites and to protect the building.

Any Visible Borer of seasoned Timbers Found

No: Please read this report in its entirety.

Any Damage caused by Wood Decay, Rot Found

Yes: please read this report in its entirety.

Evidence Of Chemical Delignification

No: Please read this report in its entirety.

NOTE

For complete and accurate information please refer to the attached complete visual timber pest report, provided in accord with as 4349.3-2010

Are further inspections recommended

Yes: Please read this report in its entirety.

Where any major safety hazards identified

No: Please read this report in its entirety.

Susceptibility of this property to timber pests

In our opinion, the susceptibility of this property to timber pests is considered to HIGH. Read the report in full.

Is a Invasive Inspection Recommended

Yes: Please read this report in its entirety.

1.3 Brief Description of the Structure Inspected

Building Type

Please refer to the description of the property outlined in the Building Inspection section of this report.

Terms and Limitations

Important Information

Any person who relies upon the contents of this report does so acknowledging that the following clauses, which define the scope and limitations of the inspection, form an integral part of the report.

1. This is a visual inspection only in accord with the requirements of as 4349.3 Inspection of buildings part 3: Timber pest inspections. This visual inspection was limited to those areas and sections of the property to which reasonable access (see definition) was both available and permitted on the date of inspection. The inspection did not include breaking apart, dismantling, removing or moving objects including, but not limited to, foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances or personal possessions. The inspector cannot see inside walls, between floors, inside skillion roofing, inside the eaves, behind stored goods in cupboards, in other areas that are concealed or obstructed. The inspector did not dig, gouge, force or perform any other invasive procedures. An invasive inspection will not be performed unless a separate contract is entered into. In an occupied property it must be understood that furnishings or household items may be concealing evidence of timber pests, which may only be revealed when the items are moved or removed. In the case of strata type properties only the interior of the unit is inspected.

2. Scope of report: This report is confined to reporting on the discovery, or non-discovery, of infestation and/or damage caused by subterranean and dampwood termites (white ants), borers of seasoned timber and wood decay fungi (hereinafter referred to as 'timber pests'), present on the date of the inspection. The inspection did not cover any other pests and this report does not comment on them. Dry wood termites (family: Kalotermitidae) and European house borer (*hylotrupes bujulus* Linnaeus) were excluded from the inspection, but have been reported on if, in the course of the inspection, any visual evidence of infestation happened to be found. If *cryptotermes brevis* (West Indian dry wood termite) or *hylotrupes bujulus* Linnaeus are discovered we are required by law to notify government authorities. If reported a special purpose report may be necessary.

3. Hidden damage: If timber pest activity and/or damage is found, within the structures or the grounds of the property, then damage may exist in concealed areas, e.g. framing timbers. An invasive inspection is strongly recommended in this case. Damage may only be found when wall linings, cladding or insulation are removed to reveal previously concealed timbers.

4. Accesibility: A further inspection is strongly recommended of those areas that were not readily accessible and of inaccessible or obstructed areas once access has been provided or the obstruction removed. At the request of the named client on this report and with the written consent of the vendor, we will revisit the site and re-Inspect the obstructed Areas at no cost to you.

5. Limitations: Nothing contained in the report implies that any inaccessible or partly inaccessible areas or sections of the property being inspected by the inspector on the date of the inspection

were not, or have not been, infested by timber pests. Accordingly this report is not a guarantee that an infestation and/or damage does not exist in any inaccessible or partly inaccessible areas or sections of the property. Nor is it a guarantee that a future infestation of timber pests will not occur or be found.

6. Determining extent of damage: The report is not a structural damage report. Any observations or recommendations about timber damage should not be taken as expert opinion and cannot be relied upon. The report will not state the full extent of any timber pest damage. The report will state timber damage found as slight, moderate, moderate to extensive or extensive. This information is not the opinion of an expert. If any evidence of timber pest activity and/or damage resulting from timber pest activity is reported either in the structure(s) or the grounds of the property, then you must assume that there may be concealed structural damage within the building(s). This concealed damage may only be found when wall linings, cladding or insulation is removed to reveal previously concealed timbers. An invasive timber pest inspection (for which a separate contract is required) is strongly recommended and you should arrange for a separate inspection by a qualified builder, engineer, or architect to carry out a structural inspection and to determine the full extent of the damage and the extent of repairs that may be required. You agree that either we or the individual conducting the inspection is responsible or liable for the repair of any damage whether disclosed by the report or not.

7. Mould: Mildew and non-wood decay fungi is commonly known as mould and is not considered a timber pest. However, mould and their spores may cause health problems or allergic reactions such as asthma and dermatitis in some people. No inspection for mould was carried out at the property and no report on the presence or absence of mould is provided. Should any evidence of mould happen to be noticed during the inspection, it will be noted in the other information (5.11) Section of this report. If mould is noted as present within the property and you are concerned as to the possible health risk resulting from its presence then you should seek advice from your local council, state or commonwealth government health department or a qualified expert such as an industry hygienist.

8. Disclaimer of liability: No liability shall be accepted on account of failure of the report to notify any termite activity and/or damage present at or prior to the date of the report in any areas(s) or section(s) of the subject property physically inaccessible for inspection, or to which access for inspection is denied by or to the licensed inspector (including but not limited to any area(s) or section(s) so specified by the report).

9. Disclaimer of liability to third parties: Compensation will only be payable for losses arising in contract or tort sustained by the client named on the front of this report. Any third party acting or relying on this report, in whole or in part, do so entirely at his or her own risk.

10. Complaints procedure: In the event of any dispute or claim arising out of, or relating to the inspection or the report, you must notify us as soon as possible of the dispute or claim by email, fax or mail. You must allow us (which includes persons nominated by us) to visit the property (which visit must occur within twenty eight (28) days of your notification to us) and give us full access in order that we may fully investigate the complaint. You will be provided with a written response to your dispute or claim within twenty eight (28) days of the date of the inspection. If you are not satisfied with our response you must within twenty one (21) days of your receipt of our written response refer the matter to a mediator nominated by us from the institute of arbitrators and mediators of Australia. The cost of the mediator will be borne equally by both parties or as agreed as part of the mediated settlement.

Should the dispute or claim not be resolved by mediation then the dispute or claim will proceed to arbitration. The institute of arbitrators and mediators of Australia will appoint an arbitrator who will hear and resolve the dispute. The arbitration, subject to any directions of the arbitrator, will proceed in the following manner:

- A)** the parties must submit all written submissions and evidence to the arbitrator within twenty one (21) days of the appointment of the arbitrator; and
- B)** the arbitration will be held within twenty one (21) days of the arbitrator receiving the written submissions.

The arbitrator will make a decision determining the dispute or claim within twenty one (21) of the final day of the arbitration. The arbitrator may, as part of his determination, determine what costs, if any, each of the parties are to pay and the time by which the parties must be paid any settlement or costs. The decision of the arbitrator is final and binding on both parties. Should the arbitrator order either party to pay any settlement amount or costs to the other party but not specify a time for payment then such payment shall be made within twenty one (21) days of the order.

In the event you do not comply with the above complaints procedure and commence litigation against us then you agree to fully indemnify us against any awards, costs, legal fees and expenses incurred by us in having your litigation set aside or adjourned to permit the foregoing complaints procedure to complete.

11. Complaint investigation: In the event any litigation is started as a result of the inspection and/or report, you indemnify us against any legal fees and expenses incurred where you have not first allowed us the opportunity to visit the property to investigate the complaint and provide you with a written response within 28 days.

2. Visual Timber Pest Inspection Report

Important Information

For complete and accurate information please refer to the attached complete visual timber pest report, provided in accord with AS 4349.3-2010

2.1 Brief Description of Areas Inspected

NOTE

Only structures, fences &or trees within 30m of the building but within the property boundaries were inspected.

The areas inspected were

Please refer to the Inspected and restricted areas in the Building Inspection section of this report.

2.2 Areas Not Inspected

Please Note

No inspection was made, and no report is submitted, of inaccessible areas. These include, but may not be limited to, cavity walls, concealed frame timbers behind tiled walls or other coverings such as Gyprock, Fibrous cement sheeting and any paneled/cladded wall, eaves, flat roofs, fully enclosed patios sub-floors, soil concealed by concrete floors, fireplace hearths, wall linings, landscaping, rubbish, floor coverings, furniture, pictures, appliances, stored items, insulation, hollow blocks/posts, etc. The inspection did not include obstructed areas, not readily accessible and inaccessible areas at the time in inspection which were inaccessible, not readily accessible or obstructed areas at the time of inspection. Locked and restricted areas were not inspected. Removing furnishings and obstructions which may be concealing evidence of defects is outside the scope of this inspection. It is strongly recommended that all obstructions be removed and full access be provided as defects may exist in these areas.

Unable to Inspect

No inspection made or report submitted to any concealed timber frames.

Refer to Building Report for areas unable to be inspected.

2.3 Reasonable Access Areas Not Available and Why

Roof Void Because

Bulk insulation restricting view of roofing timbers.

Heating and/or cooling ducts restricted an entire inspection to some areas of the roof space.

No access to the extension.

Floor boards prohibited visual inspection of the ceiling joists.

Furniture or placement of the access door restricted reasonable access to the roof space. I recommend removing same to allow access to inspect.

Note: Important Limitations for Safe and Reasonable Access

Only areas where reasonable access was available were inspected. AS 4349.3 defines reasonable access and states that access will not be available where there are safety concerns, or obstructions, or the space available is less than the following:

ROOF VOID - the dimensions of the access hole must be at least 450mm x 400mm, and, reachable by a 2.1M step ladder or 3.6M ladder, and, there is at least 600mm x 600mm of space to crawl;

ROOF EXTERIOR - must be accessible by a 3.6M ladder

Reasonable access does not include the use of destructive or invasive inspection methods. Nor does reasonable access include cutting or making access traps, or moving heavy furniture or stored goods.

Defects may exist in the inaccessible areas. It is strongly recommended that full access be granted to enable a thorough inspection to take place as it could be harbouring timber pest activity, damage or defects. Note: Where vehicles and storage has restricted a full inspection I advise that this area be cleared so a full inspection can be carried out.

Hot water storage tank restricted visual access of some roofing timbers.

Sub Floor Due To

The sub floor could not be inspected due to no access door exists to gain entry. Defects may exist in the inaccessible areas. It is strongly recommended that full access be granted to enable a thorough inspection to take place as it could be harbouring timber pest activity, damage or defects. I Strongly advise that this area be accessed so a visual inspection can be carried out.

Reasonable Access

Note: The Australian standard AS3660 refers to AS4349.3-2010 Which defines reasonable access. Access will not be available where there are safety concerns, or obstructions, or the space available is less than the following: Subfloor - Access is normally not available where dimensions are less than 500mm x 400mm for the access hole and less than 400mm of crawl space beneath the lowest bearer, or, less than 500mm beneath the lowest part of any concrete floor.

It is strongly recommended that full access be granted to enable a thorough inspection to take place as it could be harboring timber pest activity and/or damage.

Please note since a complete inspection of the above areas was not possible, timber pest activity and/or damage may exist in these areas. It is strongly recommended that full access be granted to enable a thorough inspection to take place as it could be harboring timber pest activity and/or damage.

2.4 House furnishings

Please Note

Where a property is furnished at the time of the inspection then you must understand that the furnishings and stored goods may be concealing evidence of timber pest activity. This evidence may only be revealed when the property is vacated. A further inspection of the vacant property is strongly recommended in this case no inspection was made and no report is submitted, of inaccessible areas. If a complete inspection of the areas in the dwelling was not possible, termite activity and/or damage may exist in these areas and nothing in this report implies that any inaccessible or partly inaccessible areas or sections of the property being inspected by me on the

date of the inspection were not, or have not been infested by timber pests. Accordingly, this report does not report on inaccessible areas. This includes but may not be limited to concealed frame timbers, eaves, areas concealed by concrete floors, wall linings, soil, landscaping, rubbish, floor coverings (carpet lino etc.), Furniture, pictures, appliances (dishwashers, refrigerators, washing machines, ovens, microwave ovens, heating and cooling units etc.), Stored items (clothes on floor, boxes on floor and against walls, beds against walls and the like), insulation, hollow blocks/columns/posts/poles or other architectural hollow structures. Furnishings found at this dwelling were not inspected and do not form part of this inspection.

Was the dwelling Furnished

The dwelling was fully furnished.

2.5 Areas of Visual Inspection obstructed and why

Areas Obstructed

Where present carpet conceals damage to the underside, owner's possessions, items in cupboards & furniture present throughout the building, which is preventing a thorough inspection from being undertaken. You should be aware that furnishings and/or owners possessions may be concealing evidence of timber pests and defects, which may only be revealed when items are removed or moved. It is strongly recommended that full access be gained as it could be harbouring timber pest activity, pest damage or defects.

The fireplace / chimney are harbouring areas for termite infestations. Any chimneys that have been covered or walled in are high risk areas for termite activity and an invasive inspection must be carried out to ascertain if any termites are present in this area.

There is heating and/or cooling ducting present in the roof space/void. This is preventing a full inspection from being undertaken. It is strongly recommended that full access be gained as it could be harbouring timber pest activity and/or damage.

There is insulation, present in the roof space/void. This is preventing a full inspection from being undertaken. It is strongly recommended that full access be gained as it could be harbouring timber pest activity and/or damage.

There is storage present throughout the roof void which is preventing a full/thorough visual inspection taking place. It is strongly recommended that full access be granted to enable a thorough inspection to take place as it could be harbouring timber pest activity and/or damage.

The sub floor could not be inspected due to - No access door.

Excessive vegetation restricted a visual inspection of some external areas and fencing.

Items stored on external walls,

Stored item in garage obstructed visual inspection,

There are floor board coving the joists.

Regardless of whether any obstruction were listed, the client acknowledges that no inspection was made, and no report is submitted, of obstructed areas. These include, but may not be limited to, cavity walls, concealed frame timbers behind tiled walls or other coverings such as Gyprock, Fibrous cement sheeting and any paneled/cladded wall, eaves, flat roofs, fully enclosed patios sub-floors, soil concealed by concrete floors, fireplace hearths, wall linings, landscaping, rubbish, floor coverings, furniture, pictures, appliances, stored items, insulation, hollow blocks/posts, etc.

Please Note

Please note since a complete inspection of the above areas was not possible, timber pest activity and/or damage may exist in these areas.

2.6 High Risk Areas where access should be gained

Areas of High Risk requiring Inspection

Areas of high risk area(s) to which access should be gained, or fully gained, since they may show evidence of timber pests or damage:

High Risk Areas are

The roof space top plates around the perimeter walls could not be fully accessed. Termites or termite damage may exist. Access must be made available to full inspect this area.

The sub-floor space could not be fully accessed, termites or termite damage may exist. Access must be made available to full inspect this area.

Fireplace/chimney are known harbouring areas for termite infestations. Any chimneys that have been covered or walled in are high risk areas for termite activity and an invasive inspection must be carried out to ascertain if any termites are present in this area.

Important: Where a complete inspection of the above areas was not possible, timber pest activity and/or damage may exist in these areas, further inspections are strongly recommended to areas where reasonable access is unavailable, obstructed or restricted or a high risk of possible timber pests and/or damage exists.

The garage.

Concealed timber frames including walls and roofing.

Undetected Termite Activity Risk Assessment

Due to restrictions and obstructions to the dwelling the level of undetected termite activity is considered High.

Please refer to section 4 of the terms and conditions outlined in this report.

The following further inspections are recommended

Remove bulk insulation and re-inspect.

We strongly recommend that full access be provided and a re-inspection be conducted prior to a decision to purchase.

We recommend re-inspecting this property when vacant and unfurnished. Furniture and furnishings restrict the visual inspection.

Furnished properties: Where a property is furnished at the time of the inspection the furnishings and stored goods may be concealing evidence of Timber Pest Activity. This evidence may only be revealed when the property is vacated. A further inspection of the vacant property is strongly recommended in this case.

Note: No inspection was made, and no report is submitted, of obstructed areas. These include, but may not be limited to, cavity walls, concealed frame timbers behind tiled walls or other coverings such as Gyprock, Fibrous cement sheeting and any panelled/cladded walls.

TIMBER PEST FINDINGS

3. Subterranean Termites

Were Active or Live Termites Visible

No. Of the visible and accessible areas inspected, there were no visible termites found at the time of the inspection.

3.1 Termite Nests

Was a Termite Nest Found

No termite nests found at time of inspection.

3.2 Subterranean Termite Damage or workings

Any workings or damage found

No. Of the visible and accessible areas inspected, no termite working or timber damage found at the time of the inspection.

We claim no expertise in building and if any evidence or damage has been reported then you must have a building expert determine the full extent of damage and the estimated cost of repairs or timber replacement (See Terms & Limitations)

Please Note

Where evidence of termite activity was found in the grounds then the risk to buildings is extremely high. A treatment to eradicate the termites and to protect the building(s) should be carried out in the first instance.

Extent Of Damage

We claim no expertise in building and if any evidence or damage has been reported then you must have a building expert determine the full extent of damage and the estimated cost of repairs or timber replacement (See Terms & Limitations).

If damage is visible does it present a safety risk

Important Note: Where a Major Safety Hazard is identified above, it must be attended to and/or rectified to avoid the possibility of personal injury &/or death. **VERY Important:** If live termites or any evidence of termite workings or damage was reported above within the building(s) or in the ground and fences then it must be assumed that there may be concealed termite activity and/or timber damage. This concealed activity or damage may only be found when alterations are carried out such as when wall linings, cladding or insulation are removed or if you arrange for an invasive inspection. We claim no expertise in structural engineering or building. We strongly recommend that you have a qualified person such as a Builder, Engineer, Architect or other qualified expert in the building trade determine the full extent of the damage, if any. This may require an invasive inspection. We take no responsibility for the repair of any damage whether disclosed by this report or not. (See Terms & Limitations). Where visual evidence of termite workings and/or damage is reported above, but no live termites were present at the time of inspection, you must realize that it is possible that termites are still active in the immediate vicinity and the termites may continue to cause further damage. It is not possible, without benefit of further investigation and a number of inspections over a period of time, to ascertain whether any infestation is active or inactive. Active termites may simply have not been present at the time of inspection due to a prior disturbance, climatic conditions, or they may have been utilizing an alternative feeding source. Continued, regular, inspections are essential. Unless written evidence of a termite protection program in accord with "Australian Standard 3660" with ongoing inspections is provided, you must arrange for a treatment in accord with "Australian Standard 3660" to be carried out immediately to reduce the risk of further attack. General remarks: A more thorough INVASIVE INSPECTION is available (refer to section 9 of the terms and conditions). Where any current visible evidence of Timber Pest

activity is found it is strongly recommended that a more invasive inspection be performed. Trees and stumps on the property with a diameter more than 100mm have been visually inspected for evidence of termite activity to a height of 2m where access was possible and practical. It is very difficult, and generally impossible to locate termite nests since they are underground and evidence in trees is usually well concealed. We therefore strongly recommend that you arrange to have trees test drilled for evidence of termite nests.

3.3 Any Evidence of a Previous Termite Treatment

Any Evidence of previous Treatments Found

No, there was no visible evidence or a previous termite treatment was located at the property.

Warning

Warning: If evidence of drill holes in concrete or brickwork or other signs of a possible previous treatment are reported then the treatment was probably carried out because of an active termite attack. Extensive structural damage may exist in concealed areas. You should have an invasive inspection carried out and have a builder determine the full extent of any damage and the estimated cost of repairs as the damage may only be found when wall linings etc. are removed. Normally if a termite treatment has been carried out then a durable notice should be located in the meter box indicating the type of termite shield system, treated zone or combination has been installed.

3.4 Durable Notice

Was a Treatment Notice Found

No termite management program has been installed to this property and the property is susceptible to termite attack. We strongly recommend that a termite management professional is engaged to install a program in accordance to AS3660. Talk to your inspector about recommendations.

Please Note

This firm can give no assurances with regard to work that may have been previously performed by other firms. You should obtain copies of all paperwork and make your own inquiries as to the quality of the treatment, when it was carried out and warranty information. In most cases you should arrange for a treatment in accord with Australian Standard 3660 be carried out to reduce the risk of further attack.

3.5 Timber Fungal Decay - Rot

Evidence of Wood Decay Fungi -Rot

Yes, in the following areas ,
Exterior wall cladding.

Timber Fence.

Garage door frame.

Window frame/s.

Extent of Damage Caused by Rot

The extent of rot damage is considered to be moderate.

If any evidence of fungal decay or damage is reported you should consult a building expert determine the full extent of damage and the estimated cost of repairs or timber replacement (see terms & limitations).

Does the damage present a Major Safety Hazard

No, the damage does not present a major safety hazard.

Important Note: Where a Major Safety Hazard is identified above, it must be attended to and/or rectified to avoid the possibility of personal injury & or death. We claim no expertise in building and if any evidence of fungal decay or damage is reported you should consult a building expert to determine the full extent of damage and the estimated cost of repairs or timber replacement.

3.6 Chemical Delignification

Was there any visible evidence of chemical delignification?

No evidence of chemical delignification was seen at the time of inspection.

3.7 Borer Findings

Borer Information

Borer information: *Lyctus brunneus* (powder post beetle) is not considered a significant pest of timber. Damage is confined to the sapwood so treatment or timber replacement is not usually required. However you should have a building expert investigate if any timber replacement is required. *Anobium punctatum* (furniture beetle) and *calymmaderus incisus* (Queensland pine beetle) must always be considered active unless proof of treatment is provided because one cannot determine conclusively if activity has ceased. Total timber replacement of all susceptible timbers is recommended. An alternate choice is treatment however, the evidence and damage will remain and the treatment may need to be carried out each year for up to three years.

Was Visible Evidence of Borer Damage Found

No evidence of borer damage was found at the time of inspection.

Please Note

If any evidence or damage has been reported then you must have a building expert determine the full extent of damage and the estimated cost of repairs or timber replacement (see terms & limitations). Borer activity is usually determined by the presence of exit holes and/or frass. Since a delay exists between the time of initial infestation and the appearance of these signs, it is possible that some borer activity may exist that is not discernible at the time of inspection.

3.8 Borer Recommendations

Borer Recommendations

No treatment recommended at this stage.

Note: Only *lyctus* borer/powder post borer, pin-hole borer and furniture beetle presence is inspected.

CONDUCTIVE CONDITIONS

4. Conductive Conditions to Timber Pests

Water leaks

There was water leakage detected during the inspection from the hot water overflow. This should be diverted away from the dwellings walls or into a drain.

Roof leak. This is a conducive condition to a termite infestation due to damp conditions. Consult an appropriate trade for a scope of works and cost of repairs for the issue prior to contracts becoming binding.

Please Note

Water leaks, especially in or into the sub-floor or against the external walls ie: Leaking taps, water tanks or downpipes and or guttering, increases the likelihood of termite attack. Leaking showers or leaks from other wet areas also increase the likelihood of concealed termite attack. These conditions are also conducive to borer activity and wood decay. If any leaks were reported then you must have a qualified plumber or other building expert to determine the full extent of damage and the estimated cost of repairs prior to the contract of sale becoming binding.

4.1 Hot Water Unit Overflow

Please Note

Hot water services and air conditioning units which release water alongside or near to building walls need to be connected to a drain (if this is not possible then their water outlet needs to be piped several meters away from the building) as the resulting wet area is highly conducive to termites.

Water tanks should not leak and the overflow should be adequately connected to storm water. A plumber should be engaged if the water tank overflow is not connected to storm water.

Was the overflow sufficiently drained

No. Divert hot water overflow away from the building perimeter.

Was the Air Conditioner Sufficiently Drained

No - Divert A/C overflow away from the building perimeter.

4.2 Moisture Readings

Was there any Excessive Moisture Readings

At the time of the inspection, our electronic moisture meter readings were normal.

Please Note

High moisture readings can be caused by any one of the following: Poor ventilation, ineffective drainage, leaking pipes, leaking roofs, defective flashing or by concealed termite activity. The areas of high moisture should be investigated by way of an invasive inspection. If high moisture was reported then you must have a building expert investigate the moisture and its cause and determine the full extent of damage and the estimated cost of repairs prior to contracts becoming binding.

Equipment Of Moisture detection used

Tramex Encounter Moisture Meter

If high moisture was reported then you must have a building expert investigate the moisture and its cause and determine the full extent of damage and the estimated cost of repairs prior to contracts becoming binding.

4.3 Sub Floor Ventilation

Sub-floor Ventilation is Generally

No access could not inspect or comment.

4.4 Slab Edge Exposure

Is the Slab Edge adequately Exposed

Not applicable to this type of construction.

4.5 Weep Holes and Sub Floor Vents

Were the weep holes Clear of debris

Not applicable to this type of construction.

Were the vents clear

Yes the vents were clear of debris at the time of inspection.

5. Ant Capping and Termite Shields

The Termite Shields Appear To Be

No ant capping installed. The purpose of ant capping is to prevent concealed termite entry by forcing the termites build mud tunnels around the visible sections of the ant capping enabling detection during a pest inspection. Ant capping will not prevent the entry of termites to a structure however, correctly fitted ant caps will assist in early detection. If it is not possible or practicable to retro-fit ant capping, this area should be regularly inspected by a licensed pest inspector.

Please Note

Termite shields (Ant Caps) should be in good order and condition so termite workings are exposed and visible. This helps stop termites gaining undetected entry. Missing, damaged or poor shields increase the risk of termite infestation. If considered inadequate a builder or other building expert should be consulted for further advice and recommendation.

6. Areas Found Conducive To Termite Infestation

Conductive Areas Requiring Amendments

Air conditioner overflow requires diverting to drain. This provides conducive conditions for termite infestation.

Downpipes not connected to storm water. This causes moisture and excess moisture is conducive to termite infestation.

Leaking downpipe joins. This causes moisture and excess moisture is conducive to termite infestation.

Timber fungal decay located around the home provides conducive conditions for termite infestation.

Hot water unit overflow not connected to drain. This provides conducive conditions for termite infestation.

Roof leaking internally. This is a conducive environment for termites and rot. Consult an appropriate trade for a scope of works and cost of repairs for the issue prior to contracts becoming binding.

Inadequate surface water drainage: Surface water drainage needs assessing and rectifying by a qualified plumber. This excessive moisture can cause conducive conditions for termites.

Tree/leafy environment: This property is located in a suburb which is high risk due to the environmental surrounds. It is close to large trees and parkland. A termite management plan/treatment is strongly advised.

7. Environmental Conditions

Are Trees Close to Home

Trees are in close proximity to the dwelling and within the termite foraging area. These are a favorable influence for termite infestation. Regular inspections recommended.

OVERALL ASSESSMENT

9. Overall Assessment of Property

Please Note

Where or if there has been evidence of live termites or termite damage or termite workings (mudding) found in the building(s) then the risk of a further attack is extremely high. Where evidence of live termites or termite damage or termite workings was found in the grounds but not in the buildings then the risk to buildings must be reported as high to extremely high.

Degree of Risk of Termite Infestation is

The overall degree of risk of timber pest infestation to this property appears to be high.

The overall degree of risk of timber pest infestation is a subjective assessment by the inspector at the time of the inspection taking into account many factors which include but are in no way limited to location and proximity to bush land and trees, the presence of evidence of timber pest damage or activity close to the inspected structure or within the inspected structure, conducive conditions that raise the potential of timber pest attack such as timbers in contact with soil, inaccessible areas, slab on ground construction etc, or other factors that in the inspectors opinion, raise the risk of future timber pest attack. It should be noted that even if a risk factor is high, this is not meant to deter a purchaser from purchasing the property, it is just to make them aware that increased vigilance is warranted and any recommendations regarding reducing conducive conditions or frequency of inspections should be headed by any property owner. Often, by reducing or eliminating some of the conducive conditions, the risk factor may be lowered.

10. Subterranean Termite Treatment Recommendation

Treatment Recommendation

A management program in accord with AS 3660 to protect against subterranean termites is considered to be essential.

11. Future Inspections

Future Inspections

Future inspections: AS 3660 Recommends that inspections be carried out at intervals no greater than 12 months and where timber pest pressure is greater, this interval should be shortened. Inspections will not stop timber pest infestations; however, the damage which may be caused will be reduced when the infestation is found at an early stage. Due to the degree of risk of subterranean termite infestation noted above and all other findings of this report, we strongly recommend that a full inspection and written report in accord with AS 4349.3 or AS 3660 be conducted within the time frame proposed below.

Recommended Inspection Intervals

3 Months.

12. General Remarks

Terms And Conditions

IMPORTANT INFORMATION

In relying upon this report you should read and understand the following important information. It will help explain what is involved in a timber pest inspection, the difficulties faced by a timber pest inspector and why it is not possible to guarantee that a property is free of timber pests. It also details important information about what you can do to help protect your property from timber pest attack. This information forms an integral part of the report.

1.0 DEFINITIONS: For the purpose of this inspection, the definitions below apply.

1.1 Active - The presence of live timber pests at the time of inspection.

1.2 Inactive - The absence of live timber pests at the time of inspection.

Note: Where visual evidence of inactive termite workings and/or damage is located, it is possible that termites are still active in the immediate vicinity and the termites may continue to cause further damage. It is not possible, without the benefit of further investigation and inspections over a period of time, to ascertain whether any infestation is active or inactive. Continued, regular inspections are essential.

1.3 Minor - Damage that is superficial and does not appear to require any timber replacement or repairs to be carried out.

1.4 Moderate - Damage that is more than surface damage and it is likely to necessitate timber repairs with possible replacement (if more economical or for aesthetic reasons) to be carried out.

1.5 Severe - Damage that appears to be significant and the integrity or serviceability of timbers may be impaired. Usually timbers will have to be repaired and/or replaced.

1.6 Timber Damage - It is essential that any timber damage noted in the report be referred to a suitably qualified building professional and obtain a special purpose building report relating to the extent of the timber damage. The full extent of damage may only be revealed by invasive inspection methods including probing and the removal of lining materials. This type of invasive inspection has not been carried out and you should understand that the extent and/or severity of timber damage may be found to increase significantly on such an invasive inspection. The references contained within this report that may refer to the extent of timber damage have only been included to assist in determining treatment specifications and not to quantify the damage and must not be relied upon to determine the costs of repair or replacement.

2.0 REASONABLE ACCESS: Only areas where reasonable access was available were inspected. The Australian Standard AS3660 refers to AS4349.3-2010 which defines reasonable access. Access will not be available where there are safety concerns, or obstructions, or the space available is less than the following:

ROOF SPACE - the dimensions of the access hole must be at least 500mm x 400mm, and, reachable by a 3.6M ladder, and, there is at least 600mm x 600mm of space to crawl.

SUBFLOOR - the dimensions of the access hole must be at least 500mm x 400mm and, there is at least 400mm of space to crawl beneath the lowest part of any bearer and at least 500mm below any concrete member.

ROOF EXTERIOR - must be accessible by a 3.6M ladder placed safely on the ground.

Reasonable access does not include the use of destructive or invasive inspection methods. Nor does reasonable access include cutting or making access traps, or moving heavy furniture or stored goods.

3.0 A MORE INVASIVE AND PHYSICAL INSPECTION IS AVAILABLE AND RECOMMENDED:

This inspection was a visual inspection only. As detailed above, there are many limitations to this visual inspection. With the written permission of the owner of the premises we will perform a more invasive physical inspection that involves moving or lifting of insulation, moving stored items, furniture or foliage during the inspection. We will physically touch, tap, test and where necessary force/gouge suspected accessible timbers. We will gain access to areas, where physically possible and considered practical and necessary, by way of cutting traps and access holes. This style of report is available by ordering with several days notice. Inspection time for this report will be greater than for a visual inspection. It involves disruption in the case of an occupied property, and some permanent marking is likely. You must arrange for the written permission of the owner and must acknowledge all the above information and confirm that our firm will not be held liable for any damage caused to the property. Price available on request.

4.0 CONCRETE SLAB HOMES (Part or full slab) Homes constructed on concrete slabs pose special problems with respect to detecting termite attack. If the edge of the slab is concealed by garden beds, lawns, paths, pavers or any other obstructions then it is possible for termites to effect concealed entry into the property. They can then cause extensive damage to concealed framing timbers before being detected. Even the most experienced inspector may be unable to detect their presence due to concealment by wall linings or other obstructions. Only when the termites attack

timbers in the roof void, which may be concealed by insulation, or some other visible timbers, can their presence be detected. Where termite damage is located in the roof it should be expected that concealed framing timbers (if present) may be extensively damaged. With a concrete slab home (part or full) it is imperative that you expose the edge of the slab. This may involve the excavation of soil or the complete removal of garden beds, paths, pavers or other features which concealed the slab edge. It is recommended that at least 75 millimetres of the slab edge above ground level remain exposed at all times to facilitate the detection of termite entry. Weep holes must also be kept free of obstructions at all times.

5.0 EVIDENCE OF TERMITE DAMAGE: Where evidence of termite damage was noted in any structure or on the grounds of the property, you must understand that termite damage or activity may exist in concealed areas. Termites are secretive by nature and they will often temporarily desert their workings to later return. As damage or activity may exist in concealed or inaccessible areas, a further **INVASIVE INSPECTION** is strongly recommended, see Section 3.0 - Further Invasive Inspections. Additionally, regular inspections are strongly recommended at intervals not exceeding 12 monthly and more frequently if recommended.

6.0 SUBTERRANEAN TERMITES: No Property is safe from termites! Termites are the cause of the greatest economic losses of timber in service in Australia. Independent data compiled by State Forests shows 1 in every 4 homes are attacked by termites at some stage in their life. Australia's subterranean termite species are the most destructive timber pests in the world.

How termites attack your home! The most destructive species live in large underground nests containing several hundred thousand timber-destroying insects. The problem arises when a nest matures near your home. Your home provides natural shelter and a food source for the termites. The gallery system of a single termite colony may exploit food sources over as much as one hectare, with individual galleries extending up to 50 metres or more to enter your home. Concrete slabs do not act as a barrier as termites can penetrate cracks through the slab or over the slab edge and once in contact with the timber they can excavate it often leaving only a thin veneer on the outside. If left undiscovered the economic species can cause many thousands of dollars damage and can be costly to treat.

7.0 BORERS OF DRY SEASONED TIMBERS: Borers are the larval stage of various species of beetle. The adult beetles lay their eggs within the timber. The eggs hatch out into larvae that bore through the timber. The larvae may reside totally concealed within the timber for a period of several years before passing into a dormant pupal stage. Within the pupal case they metamorphose (change) into the adult beetle that cuts a hole in the outer surface of the timber to emerge, mate and lay further eggs to continue the cycle. It is only through the presence of these emergence holes that their presence can be detected. Refer to this report (if applicable) for further information.

Anobium punctatum borer (furniture beetle). Commonly attack softwood flooring timbers, shelving timbers and timber panelling. They have the potential to cause severe timber damage if left untreated for many years. Attack by this beetle is usually observed in timbers that have been in service for 10 to 20 years or more.

Lyctus brunneus borer (powder post beetle). These borers only attack the sapwood of certain susceptible species of hardwood timber. Since it is a requirement that the structural timbers contain no more than 25% Lyctus susceptible sapwood, these borers are not normally associated with structural damage. Replacement of affected timbers is not recommended and treatment is not approved or required.

Queensland Pine Beetle borer. These borers commonly attack flooring and wall timbers. It is not possible to determine with absolute certainty whether activity exists without destruction of the timbers. We therefore recommend that it would be prudent to assume that current borer activity is present unless written evidence is available to indicate that the property has been recently treated in respect to this borer. Replacement of affected timbers is always preferred as a long term solution since, in the event of selling the property in the future it is probable that an Inspector will report the borers as active (see above). A chemical treatment to control re-infestation may be considered a less effective and lower cost option. This treatment is applied to the underside of all

soft pine flooring timbers and to other affected timbers as required.

Non-Commercial borers Are those borers that attack dead trees, logs and tree stumps. These borers are generally not considered to be a threat to timber in service (timber used in the buildings). No treatment is necessary for this species.

8.0 FUNGAL DECAY (WOOD ROT) Fungal decay is more commonly known as wood rot. Many problems with timber pests are related to excessive moisture because Termites and wood rot both require heat and moisture to survive. Small sections of minor decay can often be removed and the resulting hole filled with "Builders filler".

Areas of moderate decay will require sections of timber to be replaced. Where there is severe fungal decay the entire affected timber member should be replaced, preferably with treated hardwood.

Oregon timber is highly susceptible to Fungal Decay and should be kept well painted. Oregon was once used extensively to construct pergolas and carports and the like. The use of Oregon in external applications is generally considered to be unsuitable.

9.0 MOULD: Mildew and non-wood decay fungi is commonly known as Mould and is not considered to be a timber pest. However, Mould and their spores may cause health and allergic reactions such as asthma and dermatitis in some people. No inspection for Mould was carried out at the property and no report on the presence or absence of Mould is provided.

If Mould is noted as present within the property and you are concerned as to the possible health risk resulting from its presence then you should seek advice from your Local Council, State or Commonwealth Health Department or a qualified expert such as an Industry Hygienist.

10.0 COMPLAINTS PROCEDURE: In the event of any dispute or claim arising out of, or relating to the Inspection or the Report, You must notify Us as soon as possible of the dispute or claim by email, fax or mail. You must allow Us (which includes persons nominated by Us) to visit the property (which visit must occur within twenty eight (28) days of your notification to Us) and give Us full access in order that We may fully investigate the complaint. You will be provided with a written response to your dispute or claim within twenty eight (28) days of the date of the inspection. If You are not satisfied with our response You must within twenty one (21) days of Your receipt of Our written response refer the matter to a Mediator nominated by Us from the Institute of Arbitrators and Mediators of Australia. The cost of the Mediator will be borne equally by both parties or as agreed as part of the mediated settlement.

In the event You do not comply with the above Complaints Procedure and commence litigation against Us then You agree to fully indemnify Us against any awards, costs, legal fees and expenses incurred by Us in having your litigation set aside or adjourned to permit the foregoing Complaints Procedure to complete.

CONTACT THE INSPECTOR: Please feel free to contact the inspector who carried out this inspection. Often it is very difficult to fully explain situations, problems, access difficulties, building faults, timber pest activity and damage or their importance in a manner that is readily understandable by the reader. Should you have any difficulty in understanding anything contained within this report then you should immediately contact the inspector and have the matter explained to you. If you have any questions at all or require clarification then contact the inspector prior to acting on this report.

The Inspection and Report was carried out by: Mark Bell

Contact the Inspector on: 610473427438

For and on Behalf of: Building Assessment Unit